



## Arm Cortex-A78C (MP138)

### Software Developer Errata Notice

Date of issue: March 10, 2025

Non-Confidential

Document version: 18.0

Copyright © 2025 Arm® Limited (or its affiliates). All rights reserved.

Document ID: SDEN-1707916

This document contains all known errata since the r0p0 release of the product.



This document is Non-Confidential.

Copyright © 2025 Arm® Limited (or its affiliates). All rights reserved.

This document is protected by copyright and other intellectual property rights.

Arm only permits use of this document if you have reviewed and accepted Arm's Proprietary notice found at the end of this document.

This document (SDEN\_1707916\_18.0\_en) was issued on March 10, 2025.

There might be a later issue at <http://developer.arm.com/documentation/SDEN-1707916>

## Inclusive language commitment

Arm values inclusive communities. Arm recognizes that we and our industry have used language that can be offensive. Arm strives to lead the industry and create change.

If you find offensive language in this document, please email [terms@arm.com](mailto:terms@arm.com).

## Feedback

Arm welcomes feedback on this product and its documentation. To provide feedback on Arm Cortex-A78C (MP138), create a ticket on <https://support.developer.arm.com>.

To provide feedback on the document, fill the following survey:  
<https://developer.arm.com/documentation-feedback-survey>.

# Contents

<b>Introduction</b>	7
Scope	7
Categorization of errata	7
<b>Change Control</b>	8
<b>Errata summary table</b>	15
<b>Errata descriptions</b>	21
Category A	21
Category A (rare)	21
Category B	22
1740846 Hardware management of dirty state and the Access flag by SPE might fail, resulting in an unsupported FSC code and incorrect EC code in PMBSR_EL1 on a buffer translation	22
1827430 A transient single-bit ECC error in the MMU TC RAM might lead to stale translation in the L2 TLB	23
1827440 Atomic Store instructions to shareable write-back memory might cause memory consistency failures	24
1875701 Core might generate breakpoint exception on incorrect IA	25
1877147 Watchpoint exception on Ld/St does not report correct address in FAR or EDWAR	26
1941499 Store operation that encounters multiple hits in the TLB might access regions of memory with attributes that could not be accessed at that Exception level or Security state	28
1941713 External debugger access to Debug registers might not work during Warm reset	29
1951501 Atomic instructions with acquire semantics might not be ordered with respect to older stores with release semantics	30
2004044 Virtual to physical translation latency might not be captured for SPE records when physical address collection is disabled.	32
2004056 Incorrect programming of PMBPTR_EL1 might result in a deadlock	33
2132063 Disabling of data prefetcher with outstanding prefetch TLB miss may cause a hang	34
2242637 PDP deadlock due to CMP/CMN + B.AL/B.NV fusion	35
2376746 Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch	36
2395407 Translation table walk folding into an L1 prefetch might cause data corruption	37
2478780 Pointer Authentication controls might become corrupt	38
2712572 The core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back	40

2743228	Page crossing access that generates an MMU fault on the second page could result in a livelock	42
2772121	The core might deadlock during powerdown sequence	43
2779483	The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation	44
3031176	SPE might write to pages which lack write permission at Stage-1 or Stage-2	45
3324346	MSR PSTATE.SSBS to 0 is not fully self-synchronizing	47
3438997	When Hardware Page Aggregation (HPA) is enabled memory accesses may be translated incorrectly	48
3696291	Changing block size without break-before-make or mis-programming contiguous hint bit can lead to a livelock	50
Category B (rare)		52
2986641	PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level	52
Category C		54
1740836	RAS error reported could have incorrect value in ERR0ADDR_EL1	54
1740844	Instruction sampling bias exists in SPE implementation	55
1816420	Loss of CTI events during warm reset	56
1816423	The core might deadlock when an external debugger injects instructions using ITR register	57
1817660	Possible loss of CTI event	58
1817664	A memory mapped write to PMSSRR might falsely cause some PMU counters and counter overflow status to be reset after snapshot capture and read might return unknown/written data	59
1827435	Watchpoint Exception on DC ZVA does not report correct address in FAR	60
1827438	Memory uploads and downloads via memory access mode within Debug state can fail to accurately read or write memory contents	61
1872191	External debug accesses in memory access mode with SCTLR_ELx.IESB set might result in unpredictable behavior	63
1872195	Transient L2 tag double bit Errors might cause data corruption	64
1872198	ERR0MISC0_EL1.SUBARRAY, ERR0STATUS.CE and ERR0STATUS.DE values for ECC errors in the L1 data cache might be incorrect	65
1872201	Uncorrectable tag errors in L2 cache might cause deadlock	66
1941502	L2 data RAM may fail to report corrected ECC errors	67
1941711	IDATAN_EL3 might represent incorrect value after direct memory access to internal memory for Instruction TLB	68
1941803	PFG duplicate reported faults through a Warm reset	69

1941933	The core might report incorrect fetch address to FAR_ELx when the core is fetching an instruction from a virtual address associated with a page table entry which has been modified	70
1941936	Noncompliance with prioritization of Exception Catch debug events	71
1941939	Some corrected errors might incorrectly increment ERR0MISC0.CECR or ERR0MISC0.CECO	73
1951505	The PE might deadlock if Pseudofault Injection is enabled in Debug State	74
1983426	Incorrect fault status code might be reported in Statistical Profiling Extension register PMBSR_EL1.FSC	75
2004039	Incorrect timestamp value reported in SPE records when timestamp capture is enabled	76
2004098	DRPS might not execute correctly in Debug state with SCTLr_ELx.IESB set in the current EL	77
2091746	CPU might fetch incorrect instruction from a page programmed as non-cacheable in stage-1 translation and as device memory in stage-2 translation	78
2102457	ETM trace information records a branch to the next instruction as an N atom	79
2102759	External APB write to a register located at offset 0x084 might incorrectly issue a write to External Debug Instruction Transfer Register	80
2106992	An execution of MSR instruction might not update the destination register correctly when an external debugger initiates an APB write operation to update debug registers	82
2131905	Collision bit in PMBSR is reported incorrectly when there are multiple errors on SPE writes	84
2132043	OSECCR_EL1/EDECCR is incorrectly included in the Warm Reset domain	85
2151898	A64 WFI or A64 WFE executed in Debug state suspends execution indefinitely	86
2242641	An SError might not be reported for an atomic store that encounters data poison	88
2280349	PMU L1D_CACHE_REFILL_OUTER is inaccurate	89
2296015	L1 Data poison is not cleared by a store	90
2341664	ESR_ELx.ISV can be set incorrectly for an external abort on translation table walk	91
2346732	Lower priority exception might be reported when abort condition is detected at both stages of translation	92
2423050	Software-step not done after exit from Debug state with an illegal value in DSPSR	93
2446530	PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly	94
2699192	Incorrect value reported for SPE PMU event SAMPLE_FEED	95
2699198	Reads of DISR_EL1 incorrectly return 0s while in Debug State	96
2699762	Incorrect read value for Performance Monitors Control Register	97
2708634	DRPS instruction is not treated as UNDEFINED at EL0 in Debug state	98
2712565	Incorrect read value for Performance Monitors Configuration Register EX field	99

2764412	Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP	100
2820248	PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM	101
3605047	Incorrect count for PMU event 0x004C (L1D_TLB_REFILL_RD) might be observed	102
3607346	PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative	104
3627245	PMU event STALL_SLOT_FRONTEND counts when instruction fetch is stalled for PCRF availability	105
3633465	EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception	106
3640942	SPE operation type is corrupted under certain conditions	107
3694443	LS misses RAR hazard on case with clean critical beat and poisoned final response with ECC disabled	108
3700178	PE might fail to log a RAS error for L2 data RAM ECC errors	109
3705914	PMU events are mis-categorized by not considering the effect of "Taken locally"	110
3730890	Incorrect count for PMU event 0x400B (L3D_CACHE_LMISS_RD) might be observed	111
<b>Proprietary notice</b>		112
<b>Product and document information</b>		114
Product status		114
Product completeness status		114
Product revision status		114

# Introduction

## Scope

This document describes errata categorized by level of severity. Each description includes:

- The current status of the erratum.
- Where the implementation deviates from the specification and the conditions required for erroneous behavior to occur.
- The implications of the erratum with respect to typical applications.
- The application and limitations of a workaround where possible.

## Categorization of errata

Errata are split into three levels of severity and further qualified as common or rare:

<b>Category A</b>	A critical error. No workaround is available or workarounds are impactful. The error is likely to be common for many systems and applications.
<b>Category A (Rare)</b>	A critical error. No workaround is available or workarounds are impactful. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
<b>Category B</b>	A significant error or a critical error with an acceptable workaround. The error is likely to be common for many systems and applications.
<b>Category B (Rare)</b>	A significant error or a critical error with an acceptable workaround. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
<b>Category C</b>	A minor error.

# Change Control

Errata are listed in this section if they are new to the document, or marked as "updated" if there has been any change to the erratum text. Fixed errata are not shown as updated unless the erratum text has changed. The [errata summary table](#) identifies errata that have been fixed in each product revision.

## March 10, 2025: Changes in document version v18.0

ID	Status	Area	Category	Summary
<a href="#">3438997</a>	New	Programmer	Category B	When Hardware Page Aggregation (HPA) is enabled memory accesses may be translated incorrectly
<a href="#">3730890</a>	New	Programmer	Category C	Incorrect count for PMU event 0x400B (L3D_CACHE_LMISS_RD) might be observed

## October 01, 2024: Changes in document version v17.0

ID	Status	Area	Category	Summary
<a href="#">3696291</a>	New	Programmer	Category B	Changing block size without break-before-make or mis-programming contiguous hint bit can lead to a livelock
<a href="#">3605047</a>	New	Programmer	Category C	Incorrect count for PMU event 0x004C (L1D_TLB_REFILL_RD) might be observed
<a href="#">3607346</a>	New	Programmer	Category C	PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative
<a href="#">3627245</a>	New	Programmer	Category C	PMU event STALL_SLOT_FRONTEND counts when instruction fetch is stalled for PCRF availability
<a href="#">3633465</a>	New	Programmer	Category C	EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception
<a href="#">3640942</a>	New	Programmer	Category C	SPE operation type is corrupted under certain conditions
<a href="#">3694443</a>	New	Programmer	Category C	LS misses RAR hazard on case with clean critical beat and poisoned final response with ECC disabled
<a href="#">3700178</a>	New	Programmer	Category C	PE might fail to log a RAS error for L2 data RAM ECC errors
<a href="#">3705914</a>	New	Programmer	Category C	PMU events are mis-categorized by not considering the effect of "Taken locally"

## April 30, 2024: Changes in document version v16.0

ID	Status	Area	Category	Summary
<a href="#">3324346</a>	New	Programmer	Category B	MSR PSTATE.SSBS to 0 is not fully self-synchronizing



**August 23, 2023: Changes in document version v15.0**

ID	Status	Area	Category	Summary
<a href="#">3031176</a>	New	Programmer	Category B	SPE might write to pages which lack write permission at Stage-1 or Stage-2
<a href="#">2986641</a>	New	Programmer	Category B (rare)	PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level

**February 22, 2023: Changes in document version v14.0**

ID	Status	Area	Category	Summary
<a href="#">2820248</a>	New	Programmer	Category C	PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM

**November 09, 2022: Changes in document version v13.0**

ID	Status	Area	Category	Summary
<a href="#">2743228</a>	New	Programmer	Category B	Page crossing access that generates an MMU fault on the second page could result in a livelock
<a href="#">2772121</a>	New	Programmer	Category B	The core might deadlock during powerdown sequence
<a href="#">2779483</a>	New	Programmer	Category B	The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation
<a href="#">2764412</a>	New	Programmer	Category C	Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP

**August 04, 2022: Changes in document version v12.0**

ID	Status	Area	Category	Summary
<a href="#">2478780</a>	New	Programmer	Category B	Pointer Authentication controls might become corrupt
<a href="#">2712572</a>	New	Programmer	Category B	Core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back
<a href="#">2242641</a>	New	Programmer	Category C	An SError might not be reported for an atomic store that encounters data poison
<a href="#">2280349</a>	New	Programmer	Category C	PMU L1D_CACHE_REFILL_OUTER is inaccurate
<a href="#">2446530</a>	New	Programmer	Category C	PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly
<a href="#">2699192</a>	New	Programmer	Category C	Incorrect value reported for SPE PMU event SAMPLE_FEED
<a href="#">2699198</a>	New	Programmer	Category C	Reads of DISR_EL1 incorrectly return 0s while in Debug State
<a href="#">2699762</a>	New	Programmer	Category C	Incorrect read value for Performance Monitors Control Register
<a href="#">2708634</a>	New	Programmer	Category C	DRPS instruction is not treated as UNDEFINED at EL0 in Debug state
<a href="#">2712565</a>	New	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register EX field

## January 21, 2022: Changes in document version v11.0

ID	Status	Area	Category	Summary
<a href="#">2376746</a>	New	Programmer	Category B	Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch
<a href="#">2395407</a>	New	Programmer	Category B	Translation table walk folding into an L1 prefetch might cause data corruption
<a href="#">2341664</a>	New	Programmer	Category C	ESR_ELx.ISV can be set incorrectly for an external abort on translation table walk
<a href="#">2346732</a>	New	Programmer	Category C	Lower priority exception might be reported when abort condition is detected at both stages of translation
<a href="#">2423050</a>	New	Programmer	Category C	Software-step not done after exit from Debug state with an illegal value in DSPSR

## September 24, 2021: Changes in document version v10.0

ID	Status	Area	Category	Summary
<a href="#">2242637</a>	New	Programmer	Category B	PDP deadlock due to CMP/CMN + B.AL/B.NV fusion
<a href="#">2296015</a>	New	Programmer	Category C	L1 Data poison is not cleared by a store

## May 13, 2021: Changes in document version v9.0

ID	Status	Area	Category	Summary
<a href="#">1875701</a>	Updated	Programmer	Category B	Core might generate breakpoint exception on incorrect IA
<a href="#">2132063</a>	New	Programmer	Category B	Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock
<a href="#">1872201</a>	Updated	Programmer	Category C	Uncorrectable tag errors in L2 cache might cause deadlock
<a href="#">2004098</a>	Updated	Programmer	Category C	DRPS might not execute correctly in Debug state with SCTLR_ELx.IESB set in the current EL
<a href="#">2091746</a>	Updated	Programmer	Category C	CPU might fetch incorrect instruction from a page programmed as non-cacheable in stage-1 translation and as device memory in stage-2 translation
<a href="#">2102457</a>	Updated	Programmer	Category C	ETM trace information records a branch to the next instruction as an N atom
<a href="#">2102759</a>	Updated	Programmer	Category C	External APB write to a register located at offset 0x084 might incorrectly issue a write to External Debug Instruction Transfer Register
<a href="#">2131905</a>	New	Programmer	Category C	Collision bit in PMBSR is reported incorrectly when there are multiple errors on SPE writes
<a href="#">2132043</a>	New	Programmer	Category C	OSECCR_EL1/EDECCR is incorrectly included in the Warm Reset domain
<a href="#">2151898</a>	New	Programmer	Category C	A64 WFI or A64 WFE executed in Debug state suspends execution indefinitely

**March 03, 2021: Changes in document version v8.0**

ID	Status	Area	Category	Summary
<a href="#">2091746</a>	New	Programmer	Category C	CPU might fetch incorrect instruction from a page programmed as non-cacheable in stage-1 translation and as device memory in stage-2 translation
<a href="#">2102457</a>	New	Programmer	Category C	ETM trace information records a branch to the next instruction as an N atom
<a href="#">2102759</a>	New	Programmer	Category C	External APB write to a register located at offset 0x084 might incorrectly issue a write to External Debug Instruction Transfer Register
<a href="#">2106992</a>	New	Programmer	Category C	An execution of MSR instruction might not update the destination register correctly when an external debugger initiates an APB write operation to update debug registers

**December 09, 2020: Changes in document version v7.0**

ID	Status	Area	Category	Summary
<a href="#">1875701</a>	Updated	Programmer	Category B	Core might generate breakpoint exception on incorrect IA
<a href="#">1951505</a>	Updated	Programmer	Category C	The PE might deadlock if Pseudofault Injection is enabled in Debug State

**November 09, 2020: Changes in document version v6.0**

ID	Status	Area	Category	Summary
<a href="#">1740846</a>	Updated	Programmer	Category B	Hardware management of dirty state and the Access flag by SPE might fail, resulting in an unsupported FSC code and incorrect EC code in PMBSR_EL1 on a buffer translation
<a href="#">1827430</a>	Updated	Programmer	Category B	A transient single-bit ECC error in the MMU TC RAM might lead to stale translation in the L2 TLB
<a href="#">1827440</a>	Updated	Programmer	Category B	Atomic Store instructions to shareable write-back memory might cause memory consistency failures
<a href="#">1875701</a>	Updated	Programmer	Category B	Core might generate breakpoint exception on incorrect IA
<a href="#">1877147</a>	Updated	Programmer	Category B	Watchpoint exception on Ld/St does not report correct address in FAR or EDWAR
<a href="#">1941713</a>	Updated	Programmer	Category B	External debugger access to Debug registers might not work during Warm reset
<a href="#">1941499</a>	Updated	Programmer	Category B	Store operation that encounters multiple hits in the TLB might access regions of memory with attributes that could not be accessed at that Exception level or Security state
<a href="#">1951501</a>	Updated	Programmer	Category B	Atomic instructions with acquire semantics might not be ordered with respect to older stores with release semantics
<a href="#">2004044</a>	New	Programmer	Category B	Virtual to physical translation latency might not be captured for SPE records when physical address collection is disabled
<a href="#">2004056</a>	New	Programmer	Category B	Incorrect programming of PMBPTR_EL1 might result in a deadlock
<a href="#">1740836</a>	Updated	Programmer	Category C	RAS error reported could have incorrect value in ERROADDR_EL1
<a href="#">1740844</a>	Updated	Programmer	Category C	Instruction sampling bias exists in SPE implementation
<a href="#">1816420</a>	Updated	Programmer	Category C	Loss of CTI events during warm reset

ID	Status	Area	Category	Summary
<a href="#">1816423</a>	Updated	Programmer	Category C	The core might deadlock when an external debugger injects instructions using ITR register
<a href="#">1817660</a>	Updated	Programmer	Category C	Possible loss of CTI event
<a href="#">1817664</a>	Updated	Programmer	Category C	A memory mapped write to PMSSRR might falsely cause some PMU counters and counter overflow status to be reset after snapshot capture and read might return unknown/written data
<a href="#">1827435</a>	Updated	Programmer	Category C	Watchpoint Exception on DC ZVA does not report correct address in FAR
<a href="#">1827438</a>	Updated	Programmer	Category C	Memory uploads and downloads via memory access mode within Debug state can fail to accurately read or write memory contents
<a href="#">1872191</a>	Updated	Programmer	Category C	External debug accesses in memory access mode with SCTLR_ELx.IESB set might result in unpredictable behavior
<a href="#">1872195</a>	Updated	Programmer	Category C	Transient L2 tag double bit Errors might cause data corruption
<a href="#">1872198</a>	Updated	Programmer	Category C	ERRORMISCO_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE values for ECC errors in the L1 data cache might be incorrect
<a href="#">1872201</a>	Updated	Programmer	Category C	Uncorrectable tag errors in L2 cache might cause deadlock
<a href="#">1941803</a>	Updated	Programmer	Category C	PFG duplicate reported faults through a Warm reset
<a href="#">1941502</a>	Updated	Programmer	Category C	L2 data RAM may fail to report corrected ECC errors
<a href="#">1941939</a>	Updated	Programmer	Category C	Some corrected errors might incorrectly increment ERRORMISCO.CECC or ERRORMISCO.CECO
<a href="#">1951505</a>	Updated	Programmer	Category C	The PE might deadlock if Pseudofault Injection is enabled in Debug State
<a href="#">1983426</a>	New	Programmer	Category C	Incorrect fault status code might be reported in Statistical Profiling Extension register PMBSR_EL1.FSC
<a href="#">2004039</a>	New	Programmer	Category C	Incorrect timestamp value reported in SPE records when timestamp capture is enabled
<a href="#">2004098</a>	New	Programmer	Category C	DRPS might not execute correctly in Debug state with SCTLR_ELx.IESB set in the current EL

## September 24, 2020: Changes in document version v5.0

ID	Status	Area	Category	Summary
<a href="#">1941713</a>	New	Programmer	Category B	External debugger access to Debug registers might not work during Warm reset
<a href="#">1941499</a>	New	Programmer	Category B	Store operation that encounters multiple hits in the TLB might access regions of memory with attributes that could not be accessed at that Exception level or Security state
<a href="#">1951501</a>	New	Programmer	Category B	Atomic instructions with acquire semantics might not be ordered with respect to older stores with release semantics
<a href="#">1941803</a>	New	Programmer	Category C	PFG duplicate reported faults through a Warm reset
<a href="#">1941711</a>	New	Programmer	Category C	IDATAn_EL3 might represent incorrect value after direct memory access to internal memory for Instruction TLB
<a href="#">1941502</a>	New	Programmer	Category C	L2 data RAM may fail to report corrected ECC errors
<a href="#">1941933</a>	New	Programmer	Category C	The core might report incorrect fetch address to FAR_ELx when the core is fetching an instruction from a virtual address associated with a page table entry which has been modified
<a href="#">1941936</a>	New	Programmer	Category C	Noncompliance with prioritization of Exception Catch debug events
<a href="#">1941939</a>	New	Programmer	Category C	Some corrected errors might incorrectly increment ERRORMISCO.CECC or ERRORMISCO.CECO
<a href="#">1951505</a>	New	Programmer	Category C	The PE might deadlock if Pseudofault Injection is enabled in Debug State

## June 26, 2020: Changes in document version v4.0

ID	Status	Area	Category	Summary
<a href="#">1875701</a>	New	Programmer	Category B	Core might generate breakpoint exception on incorrect IA
<a href="#">1877147</a>	New	Programmer	Category B	Watchpoint exception on Ld/St does not report correct address in FAR or EDWAR
<a href="#">1872191</a>	New	Programmer	Category C	External debug accesses in memory access mode with SCTLR_ELx.IESB set might result in unpredictable behavior
<a href="#">1872195</a>	New	Programmer	Category C	Transient L2 tag double bit Errors might cause data corruption
<a href="#">1872198</a>	New	Programmer	Category C	ERRORMISCO_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE values for ECC errors in the L1 data cache might be incorrect
<a href="#">1872201</a>	New	Programmer	Category C	Uncorrectable tag errors in L2 cache might cause deadlock

**May 07, 2020: Changes in document version v3.0**

ID	Status	Area	Category	Summary
<a href="#">1827430</a>	New	Programmer	Category B	A transient single-bit ECC error in the MMU TC RAM might lead to stale translation in the L2 TLB
<a href="#">1827440</a>	New	Programmer	Category B	Atomic Store instructions to shareable write-back memory might cause memory consistency failures
<a href="#">1816420</a>	New	Programmer	Category C	Loss of CTI events during warm reset
<a href="#">1816423</a>	New	Programmer	Category C	The core might deadlock when an external debugger injects instructions using ITR register
<a href="#">1817660</a>	New	Programmer	Category C	Possible loss of CTI event
<a href="#">1817664</a>	New	Programmer	Category C	A memory mapped write to PMSSRR might falsely cause some PMU counters and counter overflow status to be reset after snapshot capture and read might return unknown/written data
<a href="#">1827435</a>	New	Programmer	Category C	Watchpoint Exception on DC ZVA does not report correct address in FAR
<a href="#">1827438</a>	New	Programmer	Category C	Memory uploads and downloads via memory access mode within Debug state can fail to accurately read or write memory contents

**February 14, 2020: Changes in document version v2.0**

ID	Status	Area	Category	Summary
<a href="#">1740846</a>	New	Programmer	Category B	Hardware management of dirty state and the Access flag by SPE might fail, resulting in an unsupported FSC code and incorrect EC code in PMBSR_EL1 on a buffer translation
<a href="#">1740836</a>	New	Programmer	Category C	RAS error reported could have incorrect value in ERR0ADDR_EL1
<a href="#">1740844</a>	New	Programmer	Category C	Instruction sampling bias exists in SPE implementation

**January 31, 2020: Changes in document version v1.0**

No errata in this document version.

# Errata summary table

The errata associated with this product affect the product versions described in the following table.

ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">1740846</a>	Programmer	Category B	Hardware management of dirty state and the Access flag by SPE might fail, resulting in an unsupported FSC code and incorrect EC code in PMBSR_EL1 on a buffer translation	r0p0	r0p1
<a href="#">1827430</a>	Programmer	Category B	A transient single-bit ECC error in the MMU TC RAM might lead to stale translation in the L2 TLB	r0p0	r0p1
<a href="#">1827440</a>	Programmer	Category B	Atomic Store instructions to shareable write-back memory might cause memory consistency failures	r0p0	r0p1
<a href="#">1875701</a>	Programmer	Category B	Core might generate breakpoint exception on incorrect IA	r0p0	r0p1
<a href="#">1877147</a>	Programmer	Category B	Watchpoint exception on Ld/St does not report correct address in FAR or EDWAR	r0p0	r0p1
<a href="#">1941499</a>	Programmer	Category B	Store operation that encounters multiple hits in the TLB might access regions of memory with attributes that could not be accessed at that Exception level or Security state	r0p0	r0p1
<a href="#">1941713</a>	Programmer	Category B	External debugger access to Debug registers might not work during Warm reset	r0p0	r0p1
<a href="#">1951501</a>	Programmer	Category B	Atomic instructions with acquire semantics might not be ordered with respect to older stores with release semantics	r0p0	r0p1
<a href="#">2004044</a>	Programmer	Category B	Virtual to physical translation latency might not be captured for SPE records when physical address collection is disabled	r0p0	r0p1
<a href="#">2004056</a>	Programmer	Category B	Incorrect programming of PMBPTR_EL1 might result in a deadlock	r0p0	r0p1
<a href="#">2132063</a>	Programmer	Category B	Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock	r0p0, r0p1, r0p2	Open
<a href="#">2242637</a>	Programmer	Category B	PDP deadlock due to CMP/CMN + B.AL/B.NV fusion	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">2376746</a>	Programmer	Category B	Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch	r0p0, r0p1, r0p2	Open
<a href="#">2395407</a>	Programmer	Category B	Translation table walk folding into an L1 prefetch might cause data corruption	r0p0, r0p1, r0p2	Open
<a href="#">2478780</a>	Programmer	Category B	Pointer Authentication controls might become corrupt	r0p0, r0p1, r0p2	Open
<a href="#">2712572</a>	Programmer	Category B	Core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back	r0p0, r0p1, r0p2	Open
<a href="#">2743228</a>	Programmer	Category B	Page crossing access that generates an MMU fault on the second page could result in a livelock	r0p0, r0p1, r0p2	Open
<a href="#">2772121</a>	Programmer	Category B	The core might deadlock during powerdown sequence	r0p0, r0p1, r0p2	Open
<a href="#">2779483</a>	Programmer	Category B	The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation	r0p0, r0p1, r0p2	Open
<a href="#">3031176</a>	Programmer	Category B	SPE might write to pages which lack write permission at Stage-1 or Stage-2	r0p0, r0p1, r0p2	Open
<a href="#">3324346</a>	Programmer	Category B	MSR PSTATE.SSBS to 0 is not fully self-synchronizing	r0p0, r0p1, r0p2	Open
<a href="#">3438997</a>	Programmer	Category B	When Hardware Page Aggregation (HPA) is enabled memory accesses may be translated incorrectly	r0p0, r0p1, r0p2	Open
<a href="#">3696291</a>	Programmer	Category B	Changing block size without break-before-make or mis-programming contiguous hint bit can lead to a livelock	r0p0, r0p1, r0p2	Open
<a href="#">2986641</a>	Programmer	Category B (rare)	PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level	r0p0, r0p1, r0p2	Open
<a href="#">1740836</a>	Programmer	Category C	RAS error reported could have incorrect value in ERR0ADDR_EL1	r0p0	r0p1
<a href="#">1740844</a>	Programmer	Category C	Instruction sampling bias exists in SPE implementation	r0p0	r0p1



ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">1816420</a>	Programmer	Category C	Loss of CTI events during warm reset	r0p0	r0p1
<a href="#">1816423</a>	Programmer	Category C	The core might deadlock when an external debugger injects instructions using ITR register	r0p0	r0p1
<a href="#">1817660</a>	Programmer	Category C	Possible loss of CTI event	r0p0	r0p1
<a href="#">1817664</a>	Programmer	Category C	A memory mapped write to PMSSRR might falsely cause some PMU counters and counter overflow status to be reset after snapshot capture and read might return unknown/written data	r0p0	r0p1
<a href="#">1827435</a>	Programmer	Category C	Watchpoint Exception on DC ZVA does not report correct address in FAR	r0p0	r0p1
<a href="#">1827438</a>	Programmer	Category C	Memory uploads and downloads via memory access mode within Debug state can fail to accurately read or write memory contents	r0p0	r0p1
<a href="#">1872191</a>	Programmer	Category C	External debug accesses in memory access mode with SCTLr_ELx.IESB set might result in unpredictable behavior	r0p0	r0p1
<a href="#">1872195</a>	Programmer	Category C	Transient L2 tag double bit Errors might cause data corruption	r0p0	r0p1
<a href="#">1872198</a>	Programmer	Category C	ERRORMISCO_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE values for ECC errors in the L1 data cache might be incorrect	r0p0	r0p1
<a href="#">1872201</a>	Programmer	Category C	Uncorrectable tag errors in L2 cache might cause deadlock	r0p0	r0p1
<a href="#">1941502</a>	Programmer	Category C	L2 data RAM may fail to report corrected ECC errors	r0p0	r0p1
<a href="#">1941711</a>	Programmer	Category C	IDATAN_EL3 might represent incorrect value after direct memory access to internal memory for Instruction TLB	r0p0, r0p1, r0p2	Open
<a href="#">1941803</a>	Programmer	Category C	PFG duplicate reported faults through a Warm reset	r0p0	r0p1
<a href="#">1941933</a>	Programmer	Category C	The core might report incorrect fetch address to FAR_ELx when the core is fetching an instruction from a virtual address associated with a page table entry which has been modified	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">1941936</a>	Programmer	Category C	Noncompliance with prioritization of Exception Catch debug events	r0p0, r0p1, r0p2	Open
<a href="#">1941939</a>	Programmer	Category C	Some corrected errors might incorrectly increment ERR0MISC0.CECCR or ERR0MISC0.CECO	r0p0	r0p1
<a href="#">1951505</a>	Programmer	Category C	The PE might deadlock if Pseudofault Injection is enabled in Debug State	r0p0	r0p1
<a href="#">1983426</a>	Programmer	Category C	Incorrect fault status code might be reported in Statistical Profiling Extension register PMBSR_EL1.FSC	r0p0	r0p1
<a href="#">2004039</a>	Programmer	Category C	Incorrect timestamp value reported in SPE records when timestamp capture is enabled	r0p0	r0p1
<a href="#">2004098</a>	Programmer	Category C	DRPS might not execute correctly in Debug state with SCTLR_ELx.IESB set in the current EL	r0p0, r0p1	r0p2
<a href="#">2091746</a>	Programmer	Category C	CPU might fetch incorrect instruction from a page programmed as non-cacheable in stage-1 translation and as device memory in stage-2 translation	r0p0, r0p1	r0p2
<a href="#">2102457</a>	Programmer	Category C	ETM trace information records a branch to the next instruction as an N atom	r0p0, r0p1	r0p2
<a href="#">2102759</a>	Programmer	Category C	External APB write to a register located at offset 0x084 might incorrectly issue a write to External Debug Instruction Transfer Register	r0p0, r0p1	r0p2
<a href="#">2106992</a>	Programmer	Category C	An execution of MSR instruction might not update the destination register correctly when an external debugger initiates an APB write operation to update debug registers	r0p0, r0p1, r0p2	Open
<a href="#">2131905</a>	Programmer	Category C	Collision bit in PMBSR is reported incorrectly when there are multiple errors on SPE writes	r0p0, r0p1	r0p2
<a href="#">2132043</a>	Programmer	Category C	OSECCR_EL1/EDECCR is incorrectly included in the Warm Reset domain	r0p0, r0p1	r0p2
<a href="#">2151898</a>	Programmer	Category C	A64 WFI or A64 WFE executed in Debug state suspends execution indefinitely	r0p0, r0p1, r0p2	Open
<a href="#">2242641</a>	Programmer	Category C	An SError might not be reported for an atomic store that encounters data poison	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">2280349</a>	Programmer	Category C	PMU L1D_CACHE_REFILL_OUTER is inaccurate	r0p0, r0p1, r0p2	Open
<a href="#">2296015</a>	Programmer	Category C	L1 Data poison is not cleared by a store	r0p0, r0p1, r0p2	Open
<a href="#">2341664</a>	Programmer	Category C	ESR_ELx.ISV can be set incorrectly for an external abort on translation table walk	r0p0, r0p1, r0p2	Open
<a href="#">2346732</a>	Programmer	Category C	Lower priority exception might be reported when abort condition is detected at both stages of translation	r0p0, r0p1, r0p2	Open
<a href="#">2423050</a>	Programmer	Category C	Software-step not done after exit from Debug state with an illegal value in DSPSR	r0p0, r0p1, r0p2	Open
<a href="#">2446530</a>	Programmer	Category C	PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly	r0p0, r0p1, r0p2	Open
<a href="#">2699192</a>	Programmer	Category C	Incorrect value reported for SPE PMU event SAMPLE_FEED	r0p0, r0p1, r0p2	Open
<a href="#">2699198</a>	Programmer	Category C	Reads of DISR_EL1 incorrectly return 0s while in Debug State	r0p0, r0p1, r0p2	Open
<a href="#">2699762</a>	Programmer	Category C	Incorrect read value for Performance Monitors Control Register	r0p0, r0p1, r0p2	Open
<a href="#">2708634</a>	Programmer	Category C	DRPS instruction is not treated as UNDEFINED at ELO in Debug state	r0p0, r0p1, r0p2	Open
<a href="#">2712565</a>	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register EX field	r0p0, r0p1, r0p2	Open
<a href="#">2764412</a>	Programmer	Category C	Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP	r0p0, r0p1, r0p2	Open
<a href="#">2820248</a>	Programmer	Category C	PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM	r0p0, r0p1, r0p2	Open
<a href="#">3605047</a>	Programmer	Category C	Incorrect count for PMU event 0x004C (L1D_TLB_REFILL_RD) might be observed	r0p0, r0p1, r0p2	Open
<a href="#">3607346</a>	Programmer	Category C	PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative	r0p0, r0p1, r0p2	Open
<a href="#">3627245</a>	Programmer	Category C	PMU event STALL_SLOT_FRONTEND counts when instruction fetch is stalled for PCRF availability	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
<a href="#">3633465</a>	Programmer	Category C	EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception	r0p0, r0p1, r0p2	Open
<a href="#">3640942</a>	Programmer	Category C	SPE operation type is corrupted under certain conditions	r0p0, r0p1, r0p2	Open
<a href="#">3694443</a>	Programmer	Category C	LS misses RAR hazard on case with clean critical beat and poisoned final response with ECC disabled	r0p0, r0p1, r0p2	Open
<a href="#">3700178</a>	Programmer	Category C	PE might fail to log a RAS error for L2 data RAM ECC errors	r0p0, r0p1, r0p2	Open
<a href="#">3705914</a>	Programmer	Category C	PMU events are mis-categorized by not considering the effect of "Taken locally"	r0p0, r0p1, r0p2	Open
<a href="#">3730890</a>	Programmer	Category C	Incorrect count for PMU event 0x400B (L3D_CACHE_LMISS_RD) might be observed	r0p0, r0p1, r0p2	Open

# Errata descriptions

## Category A

There are no errata in this category.

## Category A (rare)

There are no errata in this category.

## Category B

### 1740846

**Hardware management of dirty state and the Access flag by SPE might fail, resulting in an unsupported FSC code and incorrect EC code in PMBSR\_EL1 on a buffer translation**

### Status

Fault Type: Programmer Category B.

Fault Status: Present in r0p0. Fixed in r0p1.

### Description

When Stage 2 dirty and access flag updates are turned off, a failed profiling buffer translation request might result in reporting a Stage 2 Data Abort code in PMBSR\_EL1.EC. This also results in an Unsupported Exclusive or Atomic Access fault status code update in PMBSR\_EL1, which is not one of the defined FSC codes for this register.

### Configurations Affected

This erratum affects all configurations.

### Conditions

SPE is enabled and the following conditions are true:

1. Hardware Management of dirty state and access flag update in Stage 1 translations is enabled in TCR\_EL1.
2. Hardware Management of dirty state and access flag update in Stage 2 translations is disabled.

### Implications

There might be a loss of sampling data as software needs to restart the profiling session to recover from this error.

### Workaround

This erratum can be avoided by pre-dirtying the SPE buffer pages.

## 1827430

### A transient single-bit ECC error in the MMU TC RAM might lead to stale translation in the L2 TLB

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain conditions, a transient single-bit ECC error in the MMU TC RAM might prevent a TLB invalidate (TLBI) instruction from removing the entry. If the transient error is not detected for a subsequent miss request targeting the affected page, then the MMU might return a stale translation.

#### Configurations affected

All configurations are affected.

#### Conditions

All of the following conditions must be met:

1. Both stage 1 and stage 2 translations are enabled.
2. Stage 1 page or block size is larger than stage 2 page or block size.
3. MMU TC RAM entry has a transient single-bit ECC error.
4. TLBI targets the translation in the MMU TC RAM entry containing the single-bit ECC error.
5. The single-bit ECC error prevents the TLBI from removing the entry.
6. Transient single-bit ECC error goes away before a subsequent translation request matching the L2 TLB entry is issued.

#### Implications

If the above conditions are met, then the MMU might return stale translation for a subsequent access. The transient single-bit ECC error will be reported in `ERRORMISCO_EL1` register.

#### Workaround

This erratum can be avoided by setting `CPUECTLR_EL1[53]` to 1, which disables the allocation of splintered pages in the L2 TLB.

## 1827440

### Atomic Store instructions to shareable write-back memory might cause memory consistency failures

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Atomic Store instructions to shareable write-back memory that are performed as far atomics might cause memory consistency failures if the initiating PE has a shared copy of the cache line containing the addressed memory.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. PEO executes Atomic Store instruction that hits in the L1 data cache and L2 cache in the Shared state.
2. PEO changes the L2 state to Invalid, sends an invalidating snoop to the L1 data cache, and issues a AtomicStore transaction on the CHI interconnect.
3. PEO invalidating snoop to the L1 data cache is delayed due to internal queueing.

#### Implications

If the above conditions are met, PEO might not observe invalidating snoops caused by other PEs in the same coherency domain and thus might violate memory consistency for loads to the same cache line as the Atomic Store.

#### Workaround

Set CPUACTLR2\_EL1[2] to force Atomic Store operations to write-back memory to be performed in the L1 data cache.



## 1875701

### Core might generate breakpoint exception on incorrect IA

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain rare conditions, the core can generate a breakpoint exception on the instruction that is sequentially before the address specified in DBGBVR<n>\_EL1.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This exception might occur when:

1. Hardware breakpoint is enabled.
2. CPU instruction execution is not being single stepped.

#### Implications

If the above conditions are met, a breakpoint exception programmed for a given PC might instead cause a breakpoint exception for the instruction at PC-4.

#### Workaround

If software recognizes that a breakpoint exception has occurred for PC-4, when a breakpoint was expected at PC, then an instruction step should be performed.

Note: this erratum was previously published with a different workaround, which entailed setting CPUACTLR\_EL1[21] to 1'b1. That workaround should not be applied.

## 1877147

### Watchpoint exception on Ld/St does not report correct address in FAR or EDWAR

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

If a load or store crosses a cache line (cache line size = 64 bytes) and a watchpoint address targets a location in the upper cache line, the Fault Address Register (FAR) or the External Debug Watchpoint Address Register (EDWAR) (if set up for Debug Halt) will contain an incorrect address.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

Incorrect address in FAR or EDWAR appears when the:

1. Watchpoint targets a double word (or less or more) at cache line address B.
2. Load or store targets accesses two cache lines: lower cache line A and upper cache line B. The cache line size is 64 bytes.

#### Implications

FAR contains the target address of load or store.

EDWAR contains the target address of load or store if enabled for Debug Halt.

#### Workaround

There is no hardware workaround.

The following software workaround can be applied:

If the Fault Address Register (FAR) or External Debug Watchpoint Address Register (EDWAR) does not match a watchpoint, software can attempt to identify a relevant watchpoint:

a) For A DC ZVA whose address is not aligned to DCZID\_EL0.BS by rounding the faulting address down to a cache line boundary (64 bytes) and attempting to match this against active watchpoints.

Note: most software aligns addresses used by DC ZVA, and this case is expected to be rare in practice.

b) For all other loads and stores by attempting to use the address of the next cache line boundary (64 bytes) and attempting to match this against active watchpoints.

## 1941499

### Store operation that encounters multiple hits in the TLB might access regions of memory with attributes that could not be accessed at that Exception level or Security state

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain circumstances, a store operation that encounters multiple hits in the TLB can generate a prefetch request to regions of memory with attributes that could not be accessed at that Exception level or Security state.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. A store operation encounters multiple hits in the TLB due to inappropriate invalidation or misprogramming of a contiguous bit.
2. A read request is generated with a physical address and attributes that are an amalgamation of the multiple TLB entries that hit.

#### Implications

If the above conditions are met, a read request could be generated to regions of memory with attributes that could not be accessed at that Exception level or Security state. The memory location will not be updated.

#### Workaround

This erratum can be avoided by setting CPUECTLR\_EL1[8] to 1. There is a small performance cost (<0.5%) for setting this bit.

## 1941713

### External debugger access to Debug registers might not work during Warm reset

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

During Warm reset, external debugger access for Debug registers might be ignored.

#### Configurations Affected

All configurations are affected.

#### Conditions

1. Warm reset is asserted.
2. External debugger access is initiated for one of following Debug registers:
  - DBGBCR<n>\_EL1 (n=0-5)
  - DBGBVR<n>\_EL1 (n=0-5)
  - EDECCR

#### Implications

If the above conditions are met, the core might ignore the access request. The read operation might return incorrect data. The write operation might not take effect and stale data might be retained.

#### Workaround

There is no workaround.

## 1951501

### Atomic instructions with acquire semantics might not be ordered with respect to older stores with release semantics

#### Status

Fault Type: Programmer Category B.

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain conditions, atomic instructions with acquire semantics might not be ordered with respect to older instructions with release semantics. The older instruction could either be a store or store atomic.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Load atomic, CAS, or SWP with acquire but no release semantics is executed.
2. There is an older instruction with release semantics and it could either be a store to non-WB memory or a store atomic instruction that is executed as a far atomic.

#### Implications

If the above condition are met, a memory ordering violation might happen.

#### Workaround

This erratum can be avoided by inserting a DMB ST before acquire atomic instructions without release semantics. This can be implemented through execution of the following code at EL3 as soon as possible after boot:

```
LDR x0,=0x0
MSR S3_6_c15_c8_0,x0
LDR x0,= 0x10E3900002
MSR S3_6_c15_c8_2,x0
LDR x0,= 0x10FFF00083
MSR S3_6_c15_c8_3,x0
LDR x0,= 0x2001003FF
MSR S3_6_c15_c8_1,x0
```

```
LDR x0,=0x1
MSR S3_6_c15_c8_0,x0
LDR x0,= 0x10E3800082
MSR S3_6_c15_c8_2,x0
LDR x0,= 0x10FFF00083
MSR S3_6_c15_c8_3,x0
LDR x0,= 0x2001003FF
MSR S3_6_c15_c8_1,x0
```

```
LDR x0,=0x2
MSR S3_6_c15_c8_0,x0
LDR x0,= 0x10E3800200
MSR S3_6_c15_c8_2,x0
LDR x0,= 0x10FFF003E0
MSR S3_6_c15_c8_3,x0
LDR x0,= 0x2001003FF
MSR S3_6_c15_c8_1,x0
```

```
ISB
```

## 2004044

### Virtual to physical translation latency might not be captured for SPE records when physical address collection is disabled.

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Virtual address (VA) to physical address (PA) translation latency is not captured in SPE records when physical address collection is disabled at the appropriate exception level (EL).

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Physical address collection is disabled for SPE records at the appropriate EL by setting PMSCR\_EL1.PA=0 or PMSCR\_EL2.PA=0.

#### Implications

If the above conditions are met, then the translation latency value is not captured in the SPE records.

#### Workaround

Where it is acceptable to capture the physical address, this erratum can be avoided by enabling physical address sampling, by setting PMSCR\_EL1.PA = 1 and PMSCR\_EL2.PA = 1.



## 2004056

### Incorrect programming of PMBPTR\_EL1 might result in a deadlock

#### Status

Fault Type: Programmer Category B  
Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

When PMBPTR\_EL1 is incorrectly programmed to be equal to or greater than PMBLIMITR\_EL1, then under certain conditions, the CPU might deadlock.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

The erratum occurs under the following conditions:

1. SPE is enabled.
2. PMBSR\_EL1.S = 0, indicating PMBIRQ is not asserted.
3. PMBPTR\_EL1 is programmed to be equal to or greater than PMBLIMITR\_EL1.

#### Implications

If the above conditions are met, then the CPU might deadlock. Note that software written correctly will not expose this erratum.

#### Workaround

This erratum can be avoided by mediating access to the SPE control registers from a higher exception level.

A hypervisor at EL2 can configure MDCR\_EL2.E2PB to trap EL1 accesses to PMBPTR\_EL1, PMBLIMITR\_EL1, and PMBSR\_EL1. The hypervisor can mediate these accesses and maintain a shadow copy of PMBLIMITR\_EL1 such that the physical PMBLIMITR\_EL1 register has PMBLIMITR\_EL1.E clear whenever PMBPTR\_EL1.PTR >= PMBLIMITR\_EL1.LIMIT.

Firmware at EL3 can configure MDCR\_EL3.NSPB to disable SPE in the active security state and trap erroneous EL1/EL2 accesses to the SPE registers. Software written correctly should not access the SPE registers in this case.

## 2132063

### Disabling of data prefetcher with outstanding prefetch TLB miss may cause a hang

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

If the data prefetcher is disabled (by an MSR to CPUECTLR register) while a prefetch TLB miss is outstanding, the processor may hang on the next context switch.

#### Configurations Affected

All configurations are affected.

#### Conditions

- MSR write to CPUECTLR register that disables the data prefetcher.
- A TLB miss from the prefetch TLB is outstanding.

#### Implications

If the above conditions are met, a hang may occur on the next context switch.

#### Workaround

- Workaround option 1:  
If the following code surrounds the MSR, it will prevent the erratum from happening:
  - tlbi (to blind address) local version (does not have to be broadcast)
  - dsb
  - isb
  - MSR CPUECTLR - disabling the prefetcher
  - isb
- Workaround option 2:  
Place the data prefetcher in the most conservative mode instead of disabling it. This will greatly reduce prefetches but not eliminate them. This is accomplished by writing the following bits to the value indicated:
  - ecltr[7:6], PF\_MODE = 2'b11

## 2242637

### PDP deadlock due to CMP/CMN + B.AL/B.NV fusion

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

When Performance Defined Power (PDP) is enabled, a Compare (CMP) or Compare negative (CMN) instruction followed by a conditional branch of form B.AL or B.NV might cause a deadlock.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. PDP configuration is enabled.
2. Execution of CMP/CMN, followed by B.AL/B.NV.

#### Implications

If above conditions are met, then a deadlock might result, requiring a reset of the processor.

#### Workaround

This erratum can be avoided by applying following patch. These instructions are not expected to be present in the code often, so any performance impact should be minimal. The code sequence should be applied early in the boot sequence prior to any of the possible errata conditions being met.

```
LDR x0,=0x5
MSR S3_6_c15_c8_0,x0 ; MSR CPUPSELR_EL3, X0
LDR x0,=0x10F600E000
MSR S3_6_c15_c8_2,x0 ; MSR CPUPOR_EL3, X0
LDR x0,=0x10FF80E000
MSR S3_6_c15_c8_3,x0 ; MSR CPUPMR_EL3, X0
LDR x0,=0x8000000003FF
MSR S3_6_c15_c8_1,x0 ; MSR CPUPCR_EL3, X0
```

ISB

Note that there is no workaround provided for r0p0 hardware. Please contact Arm support for further details.

## 2376746

### Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

A PE executing a PLDW or PRFM PST instruction that lies on a mispredicted branch path might cause a second PE executing a store exclusive to the same cache line address to fail continuously.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. One PE is executing store exclusive.
2. A second PE has branches that are consistently mispredicted.
3. The second PE instruction stream contains a PLDW or PRFM PST instruction on the mispredicted path that accesses the same cache line address as the store exclusive executed by the first PE.
4. PLDW/PRFM PST causes an invalidation of the first PE's caches and a loss of the exclusive monitor.

#### Implications

If the above conditions are met, the store exclusive instruction might continuously fail.

#### Workaround

Set CPUACTLR2\_EL1[0] to 1 to force PLDW/PRFM ST to behave like PLD/PRFM LD and not cause invalidations to other PE caches. There might be a small performance degradation to this workaround for certain workloads that share data.

## 2395407

### Translation table walk folding into an L1 prefetch might cause data corruption

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, and r0p2. Open

#### Description

A translation table walk that matches an existing L1 prefetch with a read request outstanding on CHI might fold into the prefetch, which might lead to data corruption for a future instruction fetch.

#### Configurations Affected

This erratum affects all configurations

#### Conditions

1. In specific microarchitectural situations, the PE merges a translation table walk request with an older hardware or software prefetch L2 cache miss request.

#### Implications

If the previous conditions are met, an unrelated instruction fetch might observe incorrect data.

#### Workaround

Disable folding of demand requests into older prefetches with L2 miss requests outstanding by setting CPUACTLR2\_EL1[40] to 1.

## 2478780

### Pointer Authentication controls might become corrupt

#### Status

Fault Type: Programmer Category B

Fault Status: Present in rOp0, rOp1, and rOp2. Open.

#### Description

When the Processing Element (PE) writes to any of the following Pointer Authentication control bits, the state of the bit might become corrupt:

- SCR\_EL3.API
- HCR\_EL2.API
- SCTLR\_EL3.(ENDB,END,ENIB,ENIA)
- SCTLR\_EL2.(ENDB,END,ENIB,ENIA)
- SCTLR\_EL1.(ENDB,END,ENIB,ENIA)

This can result in Pointer Authentication related instructions exhibiting unexpected behaviors, for example improperly executing as a NOP or failing to correctly TRAP:

- AUTDA, AUTDB, AUTDZA, AUTDZB, AUTIA, AUTIA1716, AUTIASP, AUTIAZ, AUTIB, AUTIB1716, AUTIBSP, AUTIBZ, AUTIZA, AUTIZB
- PACGA, PACDA, PACDB, PACDZA, PACDZB, PACIA, PACIA1716, PACIASP, PACIAZ, PACIB, PACIB1716, PACIBSP, PACIBZ, PACIZA, PACIZB
- RETAA, RETAB, BRAA, BRAB, BLRAA, BLRAB, BRAAZ, BRABZ, BLRAAZ, BLRABZ
- ERETA, ERETAB, LDRAA, and LDRAB

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. The PE writes to any of the listed Pointer Authentication control bits.
2. The PE executes a Pointer Authentication related instruction.

#### Implications

If the above conditions are met, then the Pointer Authentication instruction might exhibit unexpected behaviors.

#### Workaround

This erratum can be avoided by flushing the mop cache following a write to registers SCR\_EL3, HCR\_EL2, or SCTLR\_ELx. This can be implemented through execution of the following code at EL3 as soon as possible after boot:

```
LDR x0,=0x3
MSR S3_6_c15_c8_0,x0 ; MSR CPUPSELR_EL3, X0
LDR x0,=0xEE010F10
MSR S3_6_c15_c8_2,x0 ; MSR CPUPOR_EL3, X0
LDR x0,=0xFF1F0FFE
MSR S3_6_c15_c8_3,x0 ; MSR CPUPMR_EL3, X0
LDR x0,=0x100000004003FF
MSR S3_6_c15_c8_1,x0 ; MSR CPUPCR_EL3, X0
ISB
```

## 2712572

### The core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

If a core is fetching instructions from memory while stage 1 translation is disabled and instruction cache is disabled, the core ignores Stage 2 forced Write-Back indication programmed by HCR\_EL2.FWB and make Non-cacheable, Normal memory request. This may cause the core to fetch stale data from memory subsystem.

#### Configurations Affected

This erratum might affect system configurations that do not use Arm interconnect IP.

#### Conditions

The erratum occurs if all the following conditions apply:

- The *Processing Element* (PE) is using EL1 translation regime.
- Stage 2 translation is enabled (HCR\_EL2.VM=1).
- Stage 1 translation is disabled (SCTLR\_EL1.M=0).
- Instruction cache is enabled from EL2 (HCR\_EL2.ID=0).
- Instruction cache is disabled from EL1 (SCTLR\_EL1.I=0).

#### Implications

If the conditions are satisfied, the core makes all instruction fetch request as Non-cacheable, Normal memory regardless of stage 2 translation output even if Stage 2 Forced Write-back is enabled. This might cause the core to fetch stale data from memory because Non-cacheable memory access does not probe any of cache hierarchy (e.g., Level-2 cache). If the bypassed cache hierarchy contains data modified by other initiators, stale data might be fetched from memory.

#### Workaround



For Hypervisor, initiating appropriate cache maintenance operations as if the core does not support stage 2 Forced Write-back feature. The cache maintenance operation should be initiated when new memory is allocated to a guest OS. This operation writeback the modified data in intermediate caches to point of coherency.

## 2743228

### Page crossing access that generates an MMU fault on the second page could result in a livelock

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

Under unusual micro-architectural conditions, a page crossing access that generates a *Memory Management Unit* (MMU) fault on the second page can result in a livelock.

#### Configurations Affected

All configurations are affected.

#### Conditions

This erratum occurs under all of the following conditions:

1. Page crossing load or store misses in the *Translation Lookaside Buffer* (TLB) and needs a translation table walk for both pages.
2. The table walk for the second page results in an MMU fault.

#### Implications

If the above conditions are met, under unusual micro-architectural conditions with just the right timing, the core could enter a livelock. This is expected to be very rare and even a slight perturbation due to external events like snoops could get the core out of livelock.

#### Workaround

This erratum can be avoided by setting CPUACTLR5\_EL1[56:55] to 2'b01.

## 2772121

### The core might deadlock during powerdown sequence

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

While powering down the *Processing Element* (PE), a correctable L2 tag ECC error might cause a deadlock in the powerdown sequence.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. Error detection and correction is enabled through ERXCTLR\_EL1.ED=1.
2. PE executes more than 24 writes to Device-nGnRnE or Device-nGnRE memory.
3. PE executes powerdown sequence as described in the *Technical Reference Manual* (TRM).

#### Implications

If the above conditions are met, the PE might deadlock during the hardware cache flush that automatically occurs as part of the powerdown sequence.

#### Workaround

Add a DSB instruction before the ISB of the powerdown code sequence specified in the TRM.

## 2779483

### The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

The Processing Element (PE) might generate memory accesses using invalidated mappings after completion of a Distributed Virtual Memory (DVM) SYNC operation.

#### Configurations Affected

All configurations are affected.

#### Conditions

This erratum can occur on a PE (PE0) only if the affected TLBI and subsequent DVM sync operations are broadcast from another PE (PE1). The TLBI and DVM sync operations executed locally by PE0 are not affected.

#### Implications

When this erratum occurs, after completion of a DVM SYNC operation, the PE can continue generating memory accesses through mappings that were invalidated by a previous TLBI operation.

#### Workaround

The erratum can be avoided by setting CPUACTLR3\_EL1[47]. Setting this chicken bit might have a small impact on power and negligible impact on performance.

## 3031176

### SPE might write to pages which lack write permission at Stage-1 or Stage-2

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

The *Statistical Profiling Extension* (SPE) uses the Stage-1 translation regime of the owning exception level in the owning Security state. Due to this erratum, the SPE might write to memory which lacks write permission at Stage-1 and/or Stage-2 of the owning exception level's translation regime, without raising a fault.

#### Configurations affected

This erratum affects all configurations that support SPE.

#### Conditions

This erratum occurs under the following conditions:

1. The SPE buffer is enabled.
2. Registers PMBPTR\_EL1 and PMBLIMITR\_EL1 are configured to include a virtual address VA\_X.
3. A valid Stage-1 translation exists for the virtual address VA\_X.
4. If Stage-2 is enabled, a valid Stage-2 translation exists for the intermediate physical address IPA\_X for the virtual address VA\_X.
5. At least one of the following conditions is true:
  - a. The Stage-1 translation for VA\_X lacks write permission.
  - b. The Stage-2 translation for IPA\_X lacks write permission.
6. None of the following apply:
  - a. Stage-1 hardware dirty bit management is enabled.
  - b. Stage-2 is enabled, and Stage-2 hardware dirty bit management is enabled.

#### Implications

The SPE might write to VA\_X rather than generating a fault. This might allow malicious software with control over SPE to corrupt memory for which it is not intended to have write access to.

#### Workaround

No hardware workaround is available.

A hypervisor at EL2 should not give virtual machines control of SPE unless the hypervisor can handle writes to any pages mapped at Stage-2.

An OS kernel at EL1 or EL2 should not configure the SPE buffer to contain any page which might lack write permission at Stage-1.

No current software is expected to have this problem.

## 3324346

### MSR PSTATE.SSBS to 0 is not fully self-synchronizing

#### Status

Fault Type: Programmer Category B

Fault Status: Present in rOp0, rOp1, and rOp2. Open.

#### Description

When PSTATE.SSBS is written to 0, the Arm Architecture specifies that side-effects are guaranteed to be visible to later instructions in the Execution stream. However, for a window of time during speculative execution of **MSR PSTATE.SSBS**, speculative store data bypassing might still occur.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if the following condition applies:

**MSR PSTATE.SSBS** executes, setting PSTATE.SSBS to 0.

#### Implications

Security sensitive code executed shortly after **MSR PSTATE.SSBS** to 0 might not be fully protected by the *Speculative Store Bypass Safe* (SSBS) feature.

#### Workaround

Software at EL3, EL2, and EL1 should follow writes to the SSBS register with an *Instruction Synchronization Barrier* (ISB) instruction to ensure that the new value of PSTATE.SSBS affects subsequent instructions in the execution stream under speculation.

A kernel at EL1 or EL2 should not advertise the presence of MRS/MSR instructions to read/write the SSBS register from ELO. Arm expects that kernels provide system calls for ELO software to modify PSTATE.SSBS when the SSBS register is not implemented and that ELO software will use this when the presence of the SSBS register is not advertised.

## 3438997

### When Hardware Page Aggregation (HPA) is enabled memory accesses may be translated incorrectly

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When Hardware Page Aggregation (HPA) is enabled memory accesses may be translated incorrectly. This may permit bypass of Stage-2 translation.

This issue has been assigned CVE ID CVE-2024-5660.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if all the following conditions apply:

1. Hardware page aggregation is enabled (CPUECTLR\_EL1[46]==0, which is the default value).
2. Stage-1 and/or Stage-2 translation is enabled for the active translation regime.
3. At Stage-1 or Stage-2 any of the following occur:
  - Translation table entries are modified to change the table or block size without following a Break-Before-Make approach.
  - Translation table entries within the same contiguous region have inconsistent values for the contiguous bit.
4. The translation table entries in condition 3 have inconsistent values for output addresses, access permissions, and/or memory attributes.
5. Complex, but not rare, microarchitectural conditions occur.

#### Implications

When all of the conditions above are met, any memory access translated by the translation table entries in condition 3 might use a Physical Address Space (PAS), Physical Address (PA), access permissions, and/or memory attributes which are not consistent with the architectural combination of Stage-1 translation and Stage-2 translation. Specifically any of the following may occur:



- The resulting PAS may be any arbitrary PAS reachable from the security state the access originated from:
  - For accesses originating from Non-secure state: Non-secure PAS only.
  - For accesses originating from Secure state: Secure or Non-secure PAS only.
- The resulting PA can be any arbitrary PA.
- The resulting access permissions can be any arbitrary access permissions.
- The resulting memory attributes can be any arbitrary memory attributes.

The resulting translation may permit software to read or write to an arbitrary PA which should not be accessible due to Stage-2 translation and/or may permit resulting memory attributes which should not be possible due to Stage-2 translation. Consequently this may allow software within a virtual machine to escalate privilege to EL2.

The resulting translation does not permit software in Normal state to read or write to any PA in the Secure PAS and consequently this does not provide a mechanism for software in Normal state to escalate privilege to Secure state.

## Workaround

The erratum can be avoided by setting CPUECTLR\_EL1[46] to 1, which will disable hardware page aggregation.

## 3696291

### Changing block size without break-before-make or mis-programming contiguous hint bit can lead to a livelock

#### Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

Under certain conditions, changing block size without break-before-make or mis-programming the contiguous bit can lead to an interruptible livelock in violation of FEAT\_BBM level 2 requirements until TLB maintenance is performed.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. The contiguous bit is mis-programmed for a set of contiguous Stage-1 or Stage-2 translation table entries.
2. A load or store crosses a page boundary within a contiguous address range such that an access for one page is translated by a translation table entry with the contiguous bit set and an access for another page is translated via a translation table entry with the contiguous bit clear.

or

1. A Stage-1 or Stage-2 translation table entry is modified without break-before-make such that a VA or IPA which was previously translated by a Page or Block entry is subsequently translated via a larger Block entry.
2. No TLB maintenance is performed to remove TLB entries for the stale Page or Block entry.
3. A load or store crosses a page boundary such that accesses for either page could be translated via the new block entry, and at least one access could have been translated by a distinct Page or Block entry prior to modification.

#### Implications

When the previous conditions are met, the load or store instruction will stall indefinitely without raising a fault. During the stall, the load or stall can be interrupted.

#### Workaround

Where software which manages the translation tables cannot ensure that it is not subject to the stall conditions, or where stalling is unacceptable, software which manages the translation tables should ignore **ID\_AA64MMFR2\_EL1.BBM** and always follow a break-before-make approach.

Where software which manages the translation tables can ensure that it is not subject to the stall conditions, and it is acceptable to transiently stall lower privileged software, software which manages the translation tables should minimize the period for which the contiguous bit is mis-programmed and minimize the period between modifying a translation table entry and invalidating TLB entries for the previous translation table entry.

## Category B (rare)

2986641

**PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level**

### Status

Fault Type: Programmer Category B (Rare)

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

### Description

Under certain conditions, the *Processing Element* (PE) might incorrectly detect a Watchpoint debug event instead of a Data Abort exception when a memory access spans multiple pages. The Data Abort is detected for the first page and the Watchpoint debug event is associated with the second page. The Watchpoint debug event detection might route the Data Abort to the incorrect target Exception level or cause the PE to enter Debug state.

Note the contents of the ESR and FAR registers capture the information associated with the Data Abort.

### Configurations affected

This erratum affects all configurations.

### Conditions

1. Watchpoints are enabled.
2. The PE executes a page split access that generates a Data Abort on the first page and a Watchpoint match on the second page.
3. The PE executes a younger load instruction that generates an external abort which coincides with a 1 cycle window when processing the Data Abort and Watchpoint debug event.

### Implications

If the previous conditions are met and EDSCR.HDE is set (enables Halting Debug on Watchpoint debug event), then the PE will enter Debug state rather than taking a Data Abort exception.

If EDSCR.HDE is not set, the PE might route the abort to the incorrect Exception level:

- If MDCR\_EL2.TDE == 0, a stage 2 Data Abort might result in a Data Abort exception taken erroneously to EL1.

- The rarity of PE internal timings required to exhibit this bug is comparable to *Reliability, Availability, and Serviceability* (RAS) error FIT rates. Expected outcome is a kernel panic that will kill the process.
- If `MDCR_EL2.TDE == 1`, a stage 1 Data Abort might result in a Data Abort exception taken erroneously to EL2.
  - This scenario is containable within a hypervisor via the software workaround outlined below.

## Workaround

There is no complete workaround for this erratum. A partial software workaround addresses the more serious scenario of a stage 1 Data Abort resulting in a Data Abort exception taken erroneously to EL2 without updating `HPFAR_EL2`.

EL2 can protect against this case as follows:

- Reserve one bit of IPA space so that `VTCTR_EL2.PS` is never the maximum supported.
- Write all 1's to `HPFAR_EL2[63:0]` before entering EL1 or EL0.
- Exceptions to EL2 due to this erratum that should have set `HPFAR_EL2` will instead use an out of range IPA. The guest should be restarted as the conditions for this erratum are rare and are not likely to be encountered again.

## Category C

1740836

### RAS error reported could have incorrect value in ERR0ADDR\_EL1

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain conditions, capacity eviction of a line which single or double bit ECC error is in the process of being reported could end up corrupting the value in ERR0ADDR\_EL1 register.

#### Configurations Affected

The erratum affects configurations with CORE\_CACHE\_PROTECTION set to TRUE.

#### Conditions

1. ECC error is detected in the L1 Data RAM.
2. RAS error is in the process of being reported and the line is replaced due to capacity eviction.

#### Implications

If the above conditions are met, ERR0ADDR\_EL1 could have incorrect value. In the case of a single bit error, the data will be corrected and in the case of a double bit error data is written out as poisoned.

#### Workaround

There is no workaround for this erratum.

## 1740844

### Instruction sampling bias exists in SPE implementation

#### Status

Fault Type: Programmer Category C  
Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

A PE that is used to perform instruction sampling using the SPE mechanism might exhibit sampling bias toward instructions that are branch targets.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. SPE configured and utilized on PE.

#### Implications

Software utilizing SPE might see unexpectedly high sample counts for branch target instructions and unexpectedly low sample counts for some instructions closely following a branch target.

#### Workaround

No hardware workaround.

## 1816420

### Loss of CTI events during warm reset

#### Status

Fault Type: Programmer Category C  
Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

ETM external output CTI events from the core to the external DebugBlock will not be reported during warm reset.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. An ETM external output CTI event occurs while warm reset is asserted.

#### Implications

The ETM external output CTI event will be dropped and any cross triggering that depends on this CTI event will not occur. For example, if the ETM external output was to be used to trigger a trace capture component to stop trace capture, then trace capture will not stop due to this event.

#### Workaround

This erratum has no workaround.



## 1816423

### The core might deadlock when an external debugger injects instructions using ITR register

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

The core might deadlock when an external debugger injects instructions by ITR register.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. An external debugger requests the core to enter debug state while the core is stalled because of an instruction abort due to a permission fault.
2. The external debugger injects instructions using the ITR register.

#### Implications

The core might deadlock if the above conditions are satisfied.

#### Workaround

This erratum has no workaround.

## 1817660

### Possible loss of CTI event

#### Status

Fault Type: Programmer Category C  
Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

A CTI event from the core to the external DebugBlock might be dropped, in rare occurrences, if close in temporal proximity to a previous CTI event.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. CTI event occurs.
2. Another CTI event occurs before completion of the processing of the previous CTI event.

#### Implications

CTI events might be dropped.

#### Workaround

This erratum has no workaround.

## 1817664

**A memory mapped write to PMSSRR might falsely cause some PMU counters and counter overflow status to be reset after snapshot capture and read might return unknown/written data**

### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

### Description:

A memory mapped write to PMSSRR at offset 0x6f4 might configure the Cycle counter and/or Performance Monitor event counters to be reset along with reset of corresponding overflow status bits in the PMOVSRR register. The register supports read/write functionality instead of RAZ/WI.

### Configurations affected

This erratum affects all configurations.

### Conditions

1. System enables PMU snapshot mechanism.
2. System performs memory mapped write of PMSSRR setting PMSSRR[x], where x is 31 or any value from 0 to 5 (inclusive).
3. Snapshot trigger is seen through a legal mechanism.

### Implications

If the above conditions are met, the corresponding counter (PMCCNTR\_ELO if x=31 or PMEVCNTR<x>\_ELO if x = [0,5]) will reset after a snapshot is taken. Further, the corresponding bit in the PMOVSRR\_ELO register will be reset.

A memory mapped read will return data that is written to these bits and 0 otherwise.

This register is supposed to have RAZ/WI functionality and no effect on other counters.

### Workaround

Avoid write of PMSSRR when system is using the PMU Snapshot mechanism.

## 1827435

### Watchpoint Exception on DC ZVA does not report correct address in FAR

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

If the watchpoint address targets a lower portion of a cache line, but not all of the cache line, and the address target of the DC ZVA falls in the upper portion of the cache line that the watchpoint does not target the FAR will contain an incorrect address.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. Watchpoint targets double word (or less or more) at address A.
2. DC ZVA targets address greater than A+7, but less than A+63. The cache line size is 64 bytes, which is a mis-aligned address.

#### Implications:

FAR contains target address of DC ZVA.

#### Workaround:

There is no hardware workaround. The common case for DC ZVA targets is to be granule aligned, thus most software will not be affected by this case.

## 1827438

### Memory uploads and downloads via memory access mode within Debug state can fail to accurately read or write memory contents

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Memory uploads via memory access mode within Debug state might fail to set EDSCR.TXfull to 1, possibly resulting in an intended memory read being skipped and erroneous memory contents being displayed for that address.

Memory downloads via memory access mode within Debug state might prematurely clear EDSCR.RXfull, possibly resulting in an intended memory write being skipped and subsequent memory access mode downloads therefore writing data to incorrect addresses.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

For memory upload:

1. The core is in Debug state having been properly set up via the external debug interface for memory upload (target to external host).
2. A series of external reads from DBGDTRTX\_ELO are used, where each read first clears EDSCR.TXfull to 0, then initiates memory uploads via PE-generated load & system register write instruction pairs, then sets EDSCR.(TXfull,ITE) to (1,1) on successful completion of each iteration.
3. Certain internal timing conditions relating to execution of a previous load instruction exist, resulting in the failure to set EDSCR.TXfull to 1 on some iteration.

For memory download:

1. The core is in Debug state having been properly set up via the external debug interface for memory download (external host to target).
2. A series of external writes to DBGDTRRX\_ELO are used, where each write first sets EDSCR.RXfull to 1, then initiates memory downloads via PE-generated system register read & store instruction pairs, then sets EDSCR.(RXfull,ITE) to (0,1) on successful completion of each iteration.
3. Certain internal timing conditions relating to execution of a previous load instruction exist, resulting in a premature clearing of EDSCR.RXfull to 0 on some iteration.

## Implications

If the above conditions are met, the failure mechanism could effectively skip an intended memory read in a memory upload loop, thus resulting in the erroneous display of data associated with the affected memory address. Or, the failure mechanism could effectively skip an intended memory write in a memory download loop, thus resulting in subsequent memory access mode downloads writing data to incorrect addresses.

## Workaround

A workaround is only needed if there is any possibility of connecting an external debugger to the core. If that possibility exists, then there are 2 separate workarounds:

1. Perform the memory upload or download operations with the debugger's FAST\_MEMORY\_ACCESS disabled. This can impact the performance of memory upload and download operations in Debug state, resulting in slight visible delays in the debugger user interface on memory upload and longer download times.  
or
2. Set CPUACTLR3\_EL1[47] in the boot sequence to prevent the faulty behavior. There is no performance impact associated with setting this bit, but there is a potential (workload dependent) power increase of approximately 1.5% total core power.

## 1872191

### External debug accesses in memory access mode with SCTLr\_ELx.IESB set might result in unpredictable behavior

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

In Debug state with SCTLr\_ELx.IESB set to 1, memory uploads and downloads executed in memory access mode might lead to unpredictable behavior for the current exception level.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. Core is In Debug state.
2. SCTLr\_ELx.IESB is set to 1 for the current exception level.
3. Memory access mode is enabled via EDSCR.MA set to 1.

#### Implications

If the above conditions are met, memory upload and download behavior is unpredictable for the current exception level and might lead to incorrect operation or results. The unpredictable behavior is limited to legal behavior at the current exception level.

#### Workaround

The erratum can be avoided by clearing SCTLr\_ELx.IESB before performing memory uploads or downloads in Debug state using memory access mode.

## 1872195

### Transient L2 tag double bit Errors might cause data corruption

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain uncommon conditions, transient double bit tag errors might cause valid cache data that is in an unrelated line in the same set to be overwritten.

#### Configurations affected

All configurations with CORE\_CACHE\_PROTECTION enabled.

#### Conditions

The following conditions must be met during additional rare timing and state conditions:

1. A double bit error (DBE) in the tag occurs shortly after the read of a line.
2. The DBE occurs before a write to that same line in a different way.
3. The DBE corrects after the write to that line.
4. An additional read is made to that line before it is evicted from the cache.

#### Implications

If the above conditions are met, the data in an unrelated line in the same set might be overwritten and corrupted. The effect on the failure rate is negligible in such a case. There is still substantial benefit being gained from the ECC logic.

#### Workaround

There is no workaround.



## 1872198

### ERR0MISCO\_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE values for ECC errors in the L1 data cache might be incorrect

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under certain conditions, the ERR0MISCO\_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE values recorded for ECC errors in the L1 data cache might be incorrect.

#### Configurations affected

This erratum affects configurations with CORE\_CACHE\_PROTECTION set to TRUE.

#### Conditions

1. The L1 data cache contains both a single-bit and double-bit ECC error on different words within the same 64-byte cacheline.
2. An access is made to the cacheline in the L1 data cache containing both the single-bit and double-bit ECC errors simultaneously.

#### Implications

If the above conditions are met, then ERR0MISCO\_EL1.SUBARRAY, ERROSTATUS.CE and ERROSTATUS.DE might have an incorrect values.

#### Workaround

There is no workaround for this erratum.

## 1872201

### Uncorrectable tag errors in L2 cache might cause deadlock

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

Under rare conditions that include the aliasing of multiple virtual addresses to a single physical address, a detected and reported double-bit ECC error in the L2 cache tag RAM might lead to a state in which an unexpected L1 cache eviction can cause a deadlock in the L2 cache.

#### Configurations affected

This erratum affects configurations with `CORE_CACHE_PROTECTION TRUE`.

#### Conditions

1. L2 cache detects and reports a tag double-bit ECC error.
2. A set of rare conditions occur within the PE's memory system.

#### Implications

If the above conditions are met, the L2 transaction queue might deadlock and never complete the prefetch operation.

#### Workaround

There is no workaround for this erratum.

## 1941502

### L2 data RAM may fail to report corrected ECC errors

#### Status

Fault Type: Programmer Category C  
Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

For specific operation types and cache states, a read of the L2 data RAM might fail to report a detected and corrected single-bit ECC error.

#### Configurations Affected

All configurations are affected.

#### Conditions

1. PE L1 data cache and L2 cache are in a SharedClean state and the exclusive monitor is armed for a given physical address.
2. PE executes a store exclusive instruction to this physical address.
3. L2 cache reads its data RAMs, and detects and corrects a single-bit ECC error.

#### Implications

If the above conditions are met, the PE will correct the error, but might fail to report it in the RAS error log registers. This can cause a small loss in diagnostic capability.

#### Workaround

There is no workaround.

## 1941711

### IDATAn\_EL3 might represent incorrect value after direct memory access to internal memory for Instruction TLB

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

After implementation-defined RAMINDEX register is programmed to initiate direct memory access to internal memory for Instruction TLB, implementation-defined IDATAn\_EL3 value represents unpredictable value.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Implementation-defined RAMINDEX register is programmed to initiate direct memory access to internal memory for Instruction TLB.

#### Implications

If the above conditions are met, IDATAn\_EL3 register might represent incorrect value for Translation regime, VMID, ASID, and VA[48:21].

#### Workaround

There is no workaround.

## 1941803

### PFG duplicate reported faults through a Warm reset

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

In certain conditions, the Pseudo-fault Generation Error Record Registers might generate duplicate faults through a Warm reset.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. ERROPFGCDN is set with a non-zero countdown value.
2. ERROPFGCTL is set to generate a pseudo-fault with ERROPFGCTL.CDEN enabled.
3. The countdown value expires, generating a pseudo-fault.
4. Warm reset asserts.

#### Implications

After the Warm reset, a second generated pseudo-fault might occur.

#### Workaround

De-assert the ERROPFGCTL control bits before asserting a Warm reset.

## 1941933

The core might report incorrect fetch address to FAR\_ELx when the core is fetching an instruction from a virtual address associated with a page table entry which has been modified

### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

### Description

When a core fetches an instruction from a virtual address that is associated with a page table entry which has been modified and the fetched block is affected by parity error, the core might report an incorrect address within the same 32B block onto the Fault Address Register (FAR).

### Configurations Affected

All configurations are affected.

### Conditions

1. The core fetches instructions from an aligned 32B virtual address block.
2. A page table entry associated with the above 32B aligned block is updated. The new translation would cause an instruction abort.
3. TLB holds the old translation since the synchronization process, for example, TLB Invalidate (TLBI) followed by Data Synchronization Barrier (DSB), was not completed.
4. Some of the fetched instructions are affected by parity error in I-cache data RAM.
5. Context synchronization events were not processed between the last executed instruction and the above instruction.

### Implications

When above conditions are satisfied, a core might report an incorrect fetch address to FAR\_ELx. The address reported in FAR\_ELx points at an earlier location in the same aligned 32B block. FAR\_ELx[63:5] still points correct virtual address.

### Workaround

There is no workaround.

## 1941936

### Noncompliance with prioritization of Exception Catch debug events

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

ARMv8.2 architecture requires that Debug state entry due to an Exception Catch debug event (generated on exception entry) occur before any asynchronous exception is taken at the first instruction in the exception handler. An asynchronous exception might be taken as a higher priority exception than Exception Catch and the Exception Catch might be missed altogether.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Debug Halting is allowed.
2. EDECCR bits are configured to catch exception entry to ELx.
3. A first exception is taken resulting in entry to ELx.
4. A second, asynchronous exception becomes visible at the same time as exception entry to ELx.
5. The second, asynchronous exception targets an Exception level ELy that is higher than ELx.

#### Implications

If the above conditions are met, the core might recognize the second exception and not enter Debug state as a result of Exception Catch on the first exception. When the handler for the second exception completes, software might return to execute the first exception handler, and assuming the core does not halt for any other reason, the first exception handler will be executed and entry to Debug state via Exception Catch will not occur.

#### Workaround

When setting Exception Catch on exceptions taken to an Exception level ELx, the debugger should do either or both of the following:

1. Ensure that Exception Catch is also set for exceptions taken to all higher Exception Levels, so that the second (asynchronous) exception generates an Exception Catch debug event.
2. Set Exception Catch for an Exception Return to ELx, so that when the second (asynchronous)

exception handler completes, the exception return to ELx generates an Exception Catch debug event.

Additionally, when a debugger detects that the core has halted on an Exception Catch to an Exception level ELy, where  $y > x$ , it should check the ELR\_ELy and SPSR\_ELy values to determine whether the exception was taken on an ELx exception vector address, meaning an Exception Catch on entry to ELx has been missed.



## 1941939

### Some corrected errors might incorrectly increment ERR0MISC0.CECR or ERR0MISC0.CECO

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

If a Corrected Error is recorded because of a bus error which has no valid location (ERR0STATUS.MV=0x0), then a subsequent Corrected Error might incorrectly increment either of the ERR0MISC0.CECR or ERR0MISC0.CECO counters.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. A Corrected Error which has no valid location (ERR0STATUS.MV=0x0) is recorded.
2. A subsequent Corrected Error occurs.

#### Implications

The subsequent Corrected Error might improperly increment either of the ERR0MISC0.CECR or ERR0MISC0.CECO counters.

#### Workaround

No workaround is expected to be required.

## 1951505

### The PE might deadlock if Pseudofault Injection is enabled in Debug State

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

If Pseudofault Injection is enabled for the PE node (ERR0PFGCTL.CDNEN=0x1) and the PE subsequently enters Debug State, then the PE might deadlock. Alternatively, if the PE is executing in Debug State and the PE enables Pseudofault Injection for the PE node (ERR0PFGCTL.CDNEN=0x1), then the PE might deadlock.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. ERR0PFGCTL.CDNEN is set to 0x1 to enable Pseudofault Injection.
2. The PE enters Debug State.

OR

1. The PE is executing in Debug State.
2. ERR0PFGCTL.CDNEN is set to 0x1 to enable Pseudofault Injection.

#### Implications

If the above conditions are met, then the PE might deadlock.

#### Workaround

Ensure ERR0PFGCTL.CDNEN=0x0 before entering Debug State and while executing in Debug State.

## 1983426

### Incorrect fault status code might be reported in Statistical Profiling Extension register PMBSR\_EL1.FSC

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

A statistical profiling buffer translation request which encounters multiple hits in the TLB might report an incorrect fault status code in PMBSR\_EL1.FSC.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Statistical Profiling Extension (SPE) is enabled.
2. A translation request is made for the statistical profiling buffer.
3. This translation request encounters multiple hits in the TLB due to incorrect invalidation or misprogramming of translation table entries.

#### Implications

If the above conditions are met, then the fault status code reported in PMBSR\_EL1.FSC might incorrectly indicate an illegal or incorrect fault status code instead of the correct TLB Conflict fault code.

#### Workaround

There is no workaround.

## 2004039

### Incorrect timestamp value reported in SPE records when timestamp capture is enabled

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

#### Description

The timestamp value that is captured in SPE records is from when the SPE record is written out to L2, as opposed to before the operation is signaled as "complete".

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Timestamp capture is enabled for SPE records at the appropriate EL by setting PMSCR\_EL1.TS or PMSCR\_EL2.TS.

#### Implications

If the above conditions are met, then the timestamp value reported in the SPE records might be outside of the sampled operation's lifetime.

For most expected use cases, the inaccuracy is not expected to be significant.

#### Workaround

There is no workaround.

## 2004098

### DRPS might not execute correctly in Debug state with SCTLR\_ELx.IESB set in the current EL

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

In Debug state with SCTLR\_ELx.IESB set to 1, the **DRPS** (debug only) instruction does not execute properly. Only partial functionality of the **DRPS** instruction is performed.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

The erratum occurs under the following conditions:

1. The core is in Debug state.
2. SCTLR\_ELx.IESB is set to 1 for the current exception level.
3. The **DRPS** instruction is executed.

#### Implications

If the above conditions are met, the **DRPS** instruction does not complete as intended, which might lead to incorrect operation or results. Register data or memory will not be corrupted. There are also no security or privilege violations.

#### Workaround

The erratum can be avoided by clearing SCTLR\_ELx.IESB followed by the insertion of an **ISB** and an **ESB** instruction in code before the **DRPS** instruction.

## 2091746

### CPU might fetch incorrect instruction from a page programmed as non-cacheable in stage-1 translation and as device memory in stage-2 translation

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

When an instruction fetch is initiated for a page programmed as non-cacheable normal memory in stage-1 translation and as device memory in stage-2 translation, the instruction memory might incorrectly return 0. This might cause an unexpected UNDEFINED exception.

#### Configurations Affected

The erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. A CPU fetch instruction from a page satisfies the following:
  - Stage-1 translation of this page is programmed as non-cacheable normal memory.
  - Stage-2 translation of this page is programmed as device memory.

#### Implications

If the above conditions are met, the CPU might read 0 from the instruction memory. This instruction might cause an unexpected UNDEFINED exception. Instruction fetches to device memory are not architecturally predictable in any case, and device memory is expected to be marked as execute never, so this erratum is not expected to cause any problems to real-world software.

#### Workaround

This erratum has no workaround.

## 2102457

### ETM trace information records a branch to the next instruction as an N atom

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

If a branch is taken to the next instruction, and if the instruction state remains the same, then the ETM traces it as an N atom rather than an E atom or branch address packet. This is incorrect as the ETM architecture says a taken branch should be traced as an E atom. This affects all forms of branches. State-changing branches are traced correctly.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This issue might occur when:

1. ETM is enabled.
2. A branch is taken to the next instruction.
3. The instruction state does not change.

#### Implications

A trace decoder that interprets an N atom to move to the next instruction in the same state without a push or pop from the return stack will correctly maintain the control flow but will not be able to infer anything from a conditional branch.

A trace decoder that checks if unconditional branches were not traced as N atom might report an error.

#### Workaround

To ensure continued control flow, ensure the trace decoder always interprets an N atom to move to the next instruction in same state without a push or pop from the return stack.

## 2102759

### External APB write to a register located at offset 0x084 might incorrectly issue a write to External Debug Instruction Transfer Register

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

The core might incorrectly issue a write to External Debug Instruction Transfer Register (EDITR) when an external APB write to another register that is located at offset 0x084 is performed in the Debug state. The following debug components share the offset alias with the EDITR register:

- ETE - TRCVIIECTLR - ViewInst Include/Exclude Control Register
- Reserved locations

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. The core is in debug state.
2. The External Debug Status and Control Register (EDSCR) cumulative error flag field is 0b0.
3. Memory access mode is disabled, in example, EDSCR.MA = 0b0.
4. The OS Lock is unlocked.
5. External APB write is performed to a memory mapped register at offset 0x084 other than the EDITR.

#### Implications

If the above conditions are met, then the core might issue a write to the EDITR and try to execute the instruction pointed to by the ITR. As a result of the execution, the following might happen:

- CPU state and/or memory might get corrupted.
- The CPU might generate an UNDEFINED exception.
- The EDSCR.ITE bit will be set to 0.

#### Workaround



Before programming any register at this offset when the PE is in Debug state, the debugger should either:

- Set the EDSCR.ERR bit by executing some Undefined instruction (e.g. writing zero to EDITR); or
- Set the OS Lock and then unlock it afterwards.

## 2106992

### An execution of MSR instruction might not update the destination register correctly when an external debugger initiates an APB write operation to update debug registers

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

When an **MSR** instruction and an APB write operation are processed on the same cycle, the **MSR** instruction might not update the destination register correctly.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. A CPU executes an **MSR** instruction to update any of following SPR registers:
  - a. DBGBCR<n>\_EL1
  - b. DBGBVR<n>\_EL1
  - c. DBGWCR<n>\_EL1
  - d. DBGWVR<n>\_EL1
  - e. OSECCR\_EL1
2. An external debugger initiates an APB write operation for any of following registers:
  - a. DBGBCR<n>
  - b. DBGBVR<n>
  - c. DBGBXVR<n>
  - d. DBGWCR<n>
  - e. DBGWVR<n>
  - f. DBGWXVR<n>
  - g. EDECCR
  - h. EDITR
3. The SPR registers (for example, OSLSR\_EL1.OSLK and EDSCR.TDA) and external pins are programmed to allow the following behavior:
  - a. The execution of an **MSR** instruction in condition 1 to update its destination register without neither a system trap nor a debug halt
  - b. The APB write operation in condition 2 to update its destination register without error
4. The **MSR** instruction execution in condition 1 and APB write operation in condition 2 happen in same

cycle.

5. The **MSR** write and the APB write are to two different registers. The architecture specifies that it is the software or debugger's responsibility to ensure writes to the same register are updated as expected.

## Implications

If the above conditions are met, an execution of the **MSR** instruction might not update the destination register correctly. The destination register might contain one of following values after execution:

1. The execution of the **MSR** instruction is ignored. The destination register of the **MSR** instruction holds an old value.
2. The execution of the **MSR** instruction writes an incorrect value to its destination register.

A external debugger and system software are expected to be coordinated to prevent conflict in these registers.

## Workaround

No workaround is required for this erratum.

## 2131905

### Collision bit in PMBSR is reported incorrectly when there are multiple errors on SPE writes

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

Collision information captured by PMBSR\_EL1.COLL might be lost under certain circumstances, when the buffer management interrupt is raised.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. A sampling collision event is detected.
2. Subsequent SPE write results in 2 SEI errors.

#### Implications

If the above conditions are met, the collision indicator in PMBSR\_EL1 is incorrectly set to 0, following the 2nd SEI error. PMBSR\_EL1 does capture and set the "Data Loss" (DL) indicator and all the other PMBSR\_EL1 fields correctly.

#### Workaround

There is no workaround for this erratum.

## 2132043

### OSECCR\_EL1/EDECCR is incorrectly included in the Warm Reset domain

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

#### Description

OSECCR\_EL1/EDECCR is incorrectly included in the Warm Reset domain. If a Warm Reset occurs, then the value in this register will be lost.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Warm Reset is asserted.

#### Implications

If the above conditions are met, then the value in OSECCR\_EL1/EDECCR will be lost.

#### Workaround

A debugger should enable a Reset Catch debug event by setting EDECCR.RCE to 1. This causes the PE to generate a Reset Catch debug event on a Warm reset, allowing the debugger to reprogram the EDECCR.

## 2151898

### A64 WFI or A64 WFE executed in Debug state suspends execution indefinitely

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

Executing an A64 WFI or WFE instruction while in Debug state results in suspension of execution, and execution cannot be resumed by the normal WFI or WFE wake-up events while in Debug state.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. The Processing Element (PE) is in Debug state and in AArch64 Execution state.
2. A WFI or WFE instruction is executed from EDITR.

#### Implications

If the above conditions are met, the PE will suspend execution.

This is not thought to be a serious erratum, because an attempt to execute a WFI or WFE instruction while in Debug state is not expected.

For WFI executed in Debug state, execution can only resume by any of the following:

- A Cold or Warm reset
- A Restart request trigger event from the Cross Trigger Interface (CTI) causing exit from Debug state, followed by a WFI wake-up event

For WFE executed in Debug state, execution can only resume by any of the following:

- A Cold or Warm reset
- A Restart request trigger event from the CTI causing exit from Debug state, followed by a WFE wake-up event
- An external event that sets the Event Register. Examples include executing an SEV instruction on another PE in the system or an event triggered by the Generic Timer.

#### Workaround

A workaround is unnecessary, because an attempt to execute a WFI or WFE instruction while in Debug state is not expected.

## 2242641

### An SError might not be reported for an atomic store that encounters data poison

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

Under certain conditions, an atomic store that encounters data poison might not report an SError.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. An atomic store that is unaligned to its data size but within a 16-byte boundary accesses memory.
2. The atomic store accesses multiple L1 data banks such that not all banks have data poison.

#### Implications

If the above conditions are met, an SError might not be reported although poisoned data is consumed. Note that the data remains poisoned in the L1 and will be reported on the next access.

#### Workaround

This erratum has no workaround.



## 2280349

### PMU L1D\_CACHE\_REFILL\_OUTER is inaccurate

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

The L1D\_CACHE\_REFILL\_OUTER PMU event 0x45 is inaccurate due to ignoring refills generated from a system cache. The L1D\_CACHE\_REFILL PMU event 0x3 should be the sum of PMU events L1D\_CACHE\_REFILL\_INNER 0x44 and L1D\_CACHE\_REFILL\_OUTER 0x45, however, due to the inaccuracy of L1D\_CACHE\_REFILL\_OUTER 0x45 it is possible that this might not be the case.

Note: L1D\_CACHE\_REFILL PMU event 0x3 does accurately count all L1D cache refills, including refills from a system cache.

#### Configurations Affected

This erratum affects all configurations which implement a system cache.

#### Conditions

This erratum occurs under the following conditions:

1. The L2 inner cache is allocated with data transferred from a system cache.

#### Implications

When the previous condition is met, the L1D\_CACHE\_REFILL\_OUTER PMU event 0x45 does not increment properly.

#### Workaround

The correct value of L1D\_CACHE\_REFILL\_OUTER PMU event 0x45 can be calculated by subtracting the value of L1D\_CACHE\_REFILL\_INNER PMU event 0x44 from L1D\_CACHE\_REFILL PMU event 0x3.

## 2296015

### L1 Data poison is not cleared by a store

#### Status

Fault Type: Programmer Category C  
Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

The L1 Data poison is not cleared by a store under certain conditions.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. A Processing Element (PE) executes a store that does not write a full word to a location that has data marked as poison.
2. The PE executes another store that writes to all bytes that contain data poison before the previous store is globally observable.

#### Implications

If the above conditions are met, then the poison bit in the L1 Data cache does not get cleared.

#### Workaround

This erratum can be avoided by inserting a DMB before and after a word-aligned store that is intended to clear the poison bit.

## 2341664

### ESR\_ELx.ISV can be set incorrectly for an external abort on translation table walk

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

When a data double bit error or external abort is encountered during a translation table walk, a synchronous exception is reported with the ISV bit set in the ESR\_ELx register.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following condition:

1. A data double bit error or external abort is encountered during a translation table walk, and a synchronous exception is reported.

#### Implications

If the previous condition is met, the ESR\_ELx.ISV bit will be set. The ESR[23:14] bits are set with the correct syndrome for the instruction making the access. That is SAS, SSE, SRT, SF, and AR are all set according to the instruction.

#### Workaround

This erratum has no workaround.

## 2346732

### Lower priority exception might be reported when abort condition is detected at both stages of translation

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When a permission fault or unsupported atomic fault is detected in the second stage of translation during stage 1 translation table walk, and there is a higher priority alignment fault due to SCTLR\_EL1.C bit not being set, then Data Abort might be generated reflecting the lower priority fault.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs when all the following conditions apply:

1. The core executes an atomic, load/store exclusive, or load-acquire/store-release instruction.
2. SCTLR\_EL1.C bit is not set and access is not aligned to size of data element.
3. A permission fault or unsupported atomic fault is detected in the second stage of translation during stage 1 translation table walk.

#### Implications

If the previous conditions are met, a Data Abort exception will be generated and incorrectly routed to EL2 with Data Fault Status Code (DFSC) of permission fault or unsupported atomic fault, when it should have been routed to EL1 with DFSC of alignment fault.

#### Workaround

This erratum has no workaround.

## 2423050

### Software-step not done after exit from Debug state with an illegal value in DSPSR

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

#### Description

On exit from Debug state, PSTATE.SS is set according to DSPSR.SS and DSPSR.M.

If DSPSR.M encodes an illegal value, then PSTATE.SS should be set according to the current Exception level. When the erratum occurs, the PE always writes PSTATE.SS to 0.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

- Software-step is enabled in current Exception level
- DSPSR.M encodes an illegal value, like:
  - M[4] set
  - M is a higher Exception level than current Exception level
  - M targets EL2 or EL1, when they are not available
- DSPSR.D is not set
- DSPSR.SS is set

#### Implications

If the previous conditions are met, then, on exit from Debug state the PE will directly take a Software-step Exception, without stepping an instruction as expected from DSPSR.SS=1.

#### Workaround

This erratum has no workaround.

## 2446530

### PMU STALL\_SLOT\_BACKEND and STALL\_SLOT\_FRONTEND events count incorrectly

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

The following Performance Monitoring Unit (PMU) events do not count correctly:

- 0x3D, STALL\_SLOT\_BACKEND, no operation sent for execution on a slot due to the backend
- 0x3E, STALL\_SLOT\_FRONTEND, no operation sent for execution on a slot due to the frontend

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

One of the PMU event counters is configured to count any of the following events:

- 0x3D, STALL\_SLOT\_BACKEND
- 0x3E, STALL\_SLOT\_FRONTEND

#### Implications

When operations are stalled in the processing element's dispatch pipeline slot, some of those slot stalls are counted as frontend stalls when they should have been counted as backend stalls, rendering PMU events 0x3D (STALL\_SLOT\_BACKEND) and 0x3E (STALL\_SLOT\_FRONTEND) inaccurate. The PMU event 0x3F (STALL\_SLOT) does still accurately reflect its intended count of "No operation sent for execution on a slot".

#### Workaround

This erratum has no workaround.

## 2699192

### Incorrect value reported for SPE PMU event SAMPLE\_FEED

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

Under certain conditions when a CMP instruction is followed by a Branch, the SAMPLE\_FEED PMU event 0x4001 is not reported.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. *Statistical Profiling Extension* (SPE) sampling is enabled.
2. SPE samples a CMP instruction, which is followed immediately by a BR instruction.

#### Implications

If the above conditions are met, then the SAMPLE\_FEED event may not be incremented.

For most expected use cases, the inaccuracy is not expected to be significant.

#### Workaround

There is no workaround.

## 2699198

### Reads of DISR\_EL1 incorrectly return 0s while in Debug State

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

When the Processing Element (PE) is in Debug State, reads of DISR\_EL1 from EL1 or EL2 with SCR\_EL3.EA=0x1 will incorrectly return 0s.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. The PE is executing in Debug State at EL1 or EL2, with SCR\_EL3.EA=0x1.
2. The PE executes an MRS to DISR\_EL1.

#### Implications

If the above conditions are met, then the read of DISR\_EL1 will incorrectly return 0s.

#### Workaround

No workaround is expected to be required.



## 2699762

### Incorrect read value for Performance Monitors Control Register

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

The Performance Monitors Control Register (PMCR\_ELO) and the External Performance Monitor Control Register (PMCR) might return an incorrect read value for the X field.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. Software writes a nonzero value to the PMCR\_ELO.X, or debugger writes a nonzero value to the PMCR.X
2. Software reads the PMCR\_ELO register, or debugger reads the PMCR register

#### Implications

The PMCR\_EL1.X or PMCR.X field incorrectly reports the value 0x1, indicating exporting of events in an IMPLEMENTATION DEFINED PMU event export bus is enabled. The expected value is 0x0, as the implementation does not include a PMU event export bus.

#### Workaround

This erratum has no workaround.

## 2708634

### DRPS instruction is not treated as UNDEFINED at EL0 in Debug state

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

In Debug state, DRPS is not treated as an UNDEFINED instruction.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. The *Processing Element* (PE) is in Debug state.
2. PE is executing at EL0.
3. PE executes DRPS instruction.

#### Implications

If the above conditions are met, then the PE will incorrectly execute DRPS as NOP instead of treating it as an UNDEFINED instruction.

#### Workaround

There is no workaround.

## 2712565

### Incorrect read value for Performance Monitors Configuration Register EX field

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

The Performance Monitors Configuration Register (PMCFGR) might return an incorrect read value for the EX field.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

This erratum occurs when the software reads the PMCFGR register.

#### Implications

The PMCFGR.EX field incorrectly reports the value 0x1, indicating exporting of events in an IMPLEMENTATION DEFINED PMU event export bus is enabled. The expected value is 0x0, as the implementation does not include a PMU event export bus.

#### Workaround

This erratum has no workaround.

## 2764412

### Incorrect value reported for SPE PMU event 0x4000 SAMPLE\_POP

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

Under certain conditions the SAMPLE\_POP PMU event 0x4000 might continue to count after SPE profiling has been disabled.

#### Configurations Affected

This erratum affects all configurations.

#### Conditions

1. *Statistical Profiling Extension* (SPE) sampling is enabled.
2. *Performance Monitoring Unit* (PMU) event counting is enabled.
3. SPE buffer is disabled, either directly by software, or indirectly via assertion of PMBIRQ, or by entry into Debug state.

#### Implications

If the previous conditions are met, then the SAMPLE\_POP event might reflect an overcounted value. The impact of this erratum is expected to be very minor for actual use cases, as SPE sampling analysis is typically performed independently from PMU event counting.

#### Workaround

If a workaround is desired, then minimization of potential overcounting of the SAMPLE\_POP event can be realized via software disable of any PMU SAMPLE\_POP event counters whenever SPE is disabled, and also upon the servicing of a PMBIRQ interrupt. For profiling of ELO workloads, software can further reduce exposure to overcounting by configuring the counter to not count at Exception levels of EL1 or higher.

## 2820248

### PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

Under certain conditions, the *Processing Element* (PE) might fail to report multiple uncorrectable *Error Correction Code* (ECC) errors that occur in the L1 data cache tag RAM.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

1. The PE detects and reports an uncorrectable ECC error in the L1 data cache tag RAM.
2. The PE detects a second uncorrectable ECC error in the L1 data cache tag RAM and an uncorrectable ECC error in the L1 data cache data RAM.

#### Implications

If the previous conditions are met, then the PE might fail to report the second uncorrectable ECC error in the L1 data cache tag RAM and the address recorded in `ERR0ADDR` might have an incorrect value. The ECC error occurring in the L1 data cache data RAM is reported correctly.

#### Workaround

No workaround is necessary. This erratum represents a condition where multiple uncorrectable ECC errors occur in a short period of time. While the PE does not report the errors correctly, ECC still provides a valuable mechanism for error detection and correction.

## 3605047

### Incorrect count for PMU event 0x004C (L1D\_TLB\_REFILL\_RD) might be observed

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

A hardware generated prefetch operation or a PRFM instruction might indicate a L1D\_TLB\_REFILL\_RD event leading to an incorrect count.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if all the following conditions apply:

1. PMU counters are configured to count event 0x004C.
2. A hardware generated prefetch or PRFM instruction might encounter a L1D TLB miss, resulting in a refill operation and triggering event 0x004C.

#### Implications

If the previous conditions are met, the count indicated by event 0x004C will not reflect the conditions specified in the Arm Architecture Reference Manual. Furthermore, this event is used in calculating the "Attributable Level 1 TLB refill rate, read" metric which by extension will not reflect an accurate rate.

#### Workaround

No workaround is required unless PMU event 0x004C is required. If a workaround is needed, this erratum can be avoided by counting three separate PMU events in place of event 0x004C:

- Event 0x0005 (L1D\_TLB\_REFILL)
- Event 0x004D (L1D\_TLB\_REFILL\_WR)
- Event 0x10E. (L1D\_TLB\_REFILL\_RD\_PF)

These events can be used to calculate an Effective event 0x004C as follows:

Effective Event 0x004C = Event 0x0005 - Event 0x004D - Event 0x010E

Effective event 0x004C can be used in place of event 0x004C in calculation of "Attributable Level 1 TLB refill rate, read" to provide an accurate rate calculation.

Arm Architecture Reference Manual relevant events:

Mnemonic	Number
L1D_TLB_REFILL	0x0005
L1D_TLB_REFILL_RD	0x004C
L1D_TLB_REFILL_WR	0x004D
L1D_TLB_RD	0x004E

Implementation Defined relevant event:

Mnemonic	Number
L1D_TLB_REFILL_RD_PF	0x010E

Arm Architecture Reference Manual relevant metric:

"Attributable Level 1 TLB refill rate, read" (Event 0x004C / Event 0x004E)

## 3607346

### PSTATE.{PAN,UAO} synchronization might not be honored while MSR PSTATE is speculative

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When software directly writes PSTATE.PAN or PSTATE.UAO with an MSR instruction, the Arm Architecture specifies that side-effects are guaranteed to be visible to later instructions in the Execution stream. However, for a window of time prior to the execution of MSR PSTATE.{PAN,UAO}, instructions following the MSR might speculatively execute with the old context, prior to re-executing non-speculatively under the new, expected context.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if the following condition applies:

- MSR PSTATE.{PAN or UAO} executes

#### Implications

Speculative execution of instructions using stale PSTATE.{UAO,PAN} context could in theory present a window of opportunity for a security attack. However, Arm security team has evaluated the practical risk to be very low, given the use-cases of the bits in question and the complexity involved in exploiting.

#### Workaround

A workaround is not expected to be required.



## 3627245

### PMU event STALL\_SLOT\_FRONTEND counts when instruction fetch is stalled for PCRF availability

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When instructions are not available to be dispatched due to Program Counter Register File (PCRF) fullness, they are counted by the STALL\_SLOT\_FRONTEND PMU event instead of the STALL\_SLOT\_BACKEND PMU event.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

This erratum occurs whenever instruction fetch is stalled due to PCRF fullness and the PMU is configured to count the STALL\_SLOT\_FRONTEND or STALL\_SLOT\_BACKEND events.

#### Implications

Correlation of STALL\_FRONTEND and STALL\_SLOT\_FRONTEND telemetry might be impacted when the PCRF is often full, because the STALL\_FRONTEND PMU event will not count under the same PCRF full conditions.

#### Workaround

This erratum has no workaround.

## 3633465

### EDSCR.STATUS not updated on Halting Step when a Load-Exclusive instruction generates a synchronous exception

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When a Load-Exclusive instruction is executed with Halting Step enabled, EDSCR.STATUS is not updated if the Load-Exclusive instruction causes a synchronous exception.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. In Debug state, the debugger enables Halting Step
2. Debug state is exited and a Load-Exclusive instruction (LDX\*/LDAX\*) is stepped
3. The Load-Exclusive generates a synchronous exception while executing

#### Implications

If the conditions are met, EDSCR.STATUS will not be updated.

#### Workaround

There is no workaround.

## 3640942

### SPE operation type is corrupted under certain conditions

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

#### Description

The FP field (Floating Point) of the operation type header in a *Statistical Profiling Extension* (SPE) record, might not be set correctly for certain *Scalable Vector Extension* (SVE) samples. The affected opcodes are FDIV, FDIVR and FSQRT.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

This erratum occurs under the following conditions:

1. SPE sampling is enabled.
2. SPE samples one of the following instructions:
  - FDIV
  - FDIVR
  - FSQRT

#### Implications

If the previous conditions are met, then the FP bit information in the SPE buffer might be inaccurate for the previous mentioned samples.

#### Workaround

There is no workaround.

## 3694443

### LS misses RAR hazard on case with clean critical beat and poisoned final response with ECC disabled

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

When PE is configured with ERROCTL.R.ED = 0, a load instruction that received data on the CPU AMBA CHI interface with some words marked Poisoned can violate internal visibility requirement.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if all the following conditions apply:

1. PE is configured with ERROCTL.R.ED = 0, disabling Error detection and correction
2. Data requested by a load instruction is received on the CPU AMBA CHI interface with some words marked Poisoned, indicating an uncorrected error has been detected in the system
3. Load consumes non-poisoned words from the returned data.
4. Another PE performs a write to one or more of the bytes consumed by the load

#### Implications

When the above conditions are met, load instruction might read stale data violating memory ordering requirements.

#### Workaround

No workaround is expected to be necessary for this erratum.

## 3700178

### PE might fail to log a RAS error for L2 data RAM ECC errors

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

Under specific circumstances, the L2 cache might fail to log a corrected or uncorrected ECC error in the PE ERXSTATUS/MISC/ADDR registers.

#### Configurations affected

This erratum affects all configurations with `CORE_CACHE_PROTECTION` set to `TRUE`.

#### Conditions

The erratum occurs if all the following conditions apply:

1. Error correction is enabled with `ERROCTL.ED` set to 1.
2. PE is performing simultaneous memory reads to both Device or Normal Non-cacheable and Normal-WriteBack memory.
3. Specific timing conditions occur.
4. PE detects an ECC error in the L2 data RAM.

#### Implications

If the specified conditions occur, the PE might not report the ECC error detected by the L2.

Note that there is no silent data corruption - any consumers of the data will receive a poison indication along with the data. The issue is a failure to report the error to the RAS error log.

#### Workaround

No workaround is necessary for this erratum.

## 3705914

### PMU events are mis-categorized by not considering the effect of "Taken locally"

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

FEAT\_VHE establishes broad use of "Taken locally" as a qualifier that determines which instances of an exception are counted by particular PMU events.

PMU events are mis-categorized by failing to consider "Taken locally", specifically resulting in mis-categorizations between PMU events EXC\_UNDEF and EXC\_TRAP\_OTHER, as well as between PMU events EXC\_SVC and EXC\_TRAP\_OTHER.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum can occur if one of the following conditions apply:

1. When the effective value of HCR\_EL2.{E2H,TGE} **is** {1,1}, an exception can increment PMU event 0x008D EXC\_TRAP\_OTHER, when the exception should instead increment PMU event 0x0081 EXC\_UNDEF.
2. When the effective value of HCR\_EL2.{E2H,TGE} is **NOT** {1,1}, an exception can increment PMU event 0x0081 EXC\_UNDEF, when the exception should instead increment PMU event 0x008D EXC\_TRAP\_OTHER.
3. When the effective value of HCR\_EL2.{E2H,TGE} is **NOT** {1,1}, executing an SVC instruction can increment PMU event 0x0082 EXC\_SVC, when that SVC instruction should instead increment PMU event 0x008D EXC\_TRAP\_OTHER.

#### Implications

When the previous conditions are met, PMU event counts might be inaccurate for events 0x0081, 0x0082, and 0x008D.

#### Workaround

There is no workaround.

## 3730890

### Incorrect count for PMU event 0x400B (L3D\_CACHE\_LMISS\_RD) might be observed

#### Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

#### Description

A PRFM instruction might indicate a L3D\_CACHE\_LMISS\_RD PMU event leading to an incorrect count.

#### Configurations affected

This erratum affects all configurations.

#### Conditions

The erratum occurs if all the following conditions apply:

1. PMU counters are configured to count event 0x400B (L3D\_CACHE\_LMISS\_RD).
2. PRFM instruction causes a refill into the L3D cache.

#### Implications

If the previous conditions are met, the count indicated by event 0x400B (L3D\_CACHE\_LMISS\_RD) will not match the conditions specified in the Arm Architecture Reference Manual.

#### Workaround

There is no workaround.

# Proprietary notice

This document is protected by copyright and other related rights and the use or implementation of the information contained in this document may be protected by one or more patents or pending patent applications. No part of this document may be reproduced in any form by any means without the express prior written permission of Arm Limited ("Arm"). No license, express or implied, by estoppel or otherwise to any intellectual property rights is granted by this document unless specifically stated.

Your access to the information in this document is conditional upon your acceptance that you will not use or permit others to use the information for the purposes of determining whether the subject matter of this document infringes any third party patents.

The content of this document is informational only. Any solutions presented herein are subject to changing conditions, information, scope, and data. This document was produced using reasonable efforts based on information available as of the date of issue of this document. The scope of information in this document may exceed that which Arm is required to provide, and such additional information is merely intended to further assist the recipient and does not represent Arm's view of the scope of its obligations. You acknowledge and agree that you possess the necessary expertise in system security and functional safety and that you shall be solely responsible for compliance with all legal, regulatory, safety and security related requirements concerning your products, notwithstanding any information or support that may be provided by Arm herein. In addition, you are responsible for any applications which are used in conjunction with any Arm technology described in this document, and to minimize risks, adequate design and operating safeguards should be provided for by you.

This document may include technical inaccuracies or typographical errors. THIS DOCUMENT IS PROVIDED "AS IS". ARM PROVIDES NO REPRESENTATIONS AND NO WARRANTIES, EXPRESS, IMPLIED OR STATUTORY, INCLUDING, WITHOUT LIMITATION, THE IMPLIED WARRANTIES OF MERCHANTABILITY, SATISFACTORY QUALITY, NON-INFRINGEMENT OR FITNESS FOR A PARTICULAR PURPOSE WITH RESPECT TO THE DOCUMENT. For the avoidance of doubt, Arm makes no representation with respect to, and has undertaken no analysis to identify or understand the scope and content of, any patents, copyrights, trade secrets, trademarks, or other rights.

TO THE EXTENT NOT PROHIBITED BY LAW, IN NO EVENT WILL ARM BE LIABLE FOR ANY DAMAGES, INCLUDING WITHOUT LIMITATION ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, PUNITIVE, OR CONSEQUENTIAL DAMAGES, HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY, ARISING OUT OF ANY USE OF THIS DOCUMENT, EVEN IF ARM HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

Reference by Arm to any third party's products or services within this document is not an express or implied approval or endorsement of the use thereof.

This document consists solely of commercial items. You shall be responsible for ensuring that any permitted use, duplication or disclosure of this document complies fully with any relevant export laws and regulations to assure that this document or any portion thereof is not exported, directly or indirectly, in violation of such export laws. Use of the word "partner" in reference to Arm's customers is not intended to create or refer to any partnership relationship with any other company. Arm may make changes to this document at any time and without notice.

This document may be translated into other languages for convenience, and you agree that if there is any conflict between the English version of this document and any translation, the terms of the English version of this document shall prevail.

The validity, construction and performance of this notice shall be governed by English Law.



The Arm corporate logo and words marked with ® or ™ are registered trademarks or trademarks of Arm Limited (or its affiliates) in the US and/or elsewhere. Please follow Arm's trademark usage guidelines at <https://www.arm.com/company/policies/trademarks>. All rights reserved. Other brands and names mentioned in this document may be the trademarks of their respective owners.

Arm Limited. Company 02557590 registered in England.

110 Fulbourn Road, Cambridge, England CB1 9NJ.

(PRE-1121-V1.0)

# Product and document information

Read the information in these sections to understand the release status of the product and documentation, and the conventions used in the Arm documents.

## Product status

All products and Services provided by Arm require deliverables to be prepared and made available at different levels of completeness. The information in this document indicates the appropriate level of completeness for the associated deliverables.

### Product completeness status

The information in this document is for a product in development and is not final.

### Product revision status

The rxpy identifier indicates the revision status of the product described in this manual, where:

**rx**

Identifies the major revision of the product.

**py**

Identifies the minor revision or modification status of the product.