



Arm Neoverse V2 (MP158)

Software Developer Errata Notice

Date of issue: 30-Aug-2023

Non-Confidential

Document version: 7.0

Copyright © 2023 Arm® Limited (or its affiliates). All rights reserved.

Document ID: SDEN-2332927

This document contains all known errata since the r0p0 release of the product.



Non-confidential proprietary notice

This document is protected by copyright and other related rights and the practice or implementation of the information contained in this document may be protected by one or more patents or pending patent applications. No part of this document may be reproduced in any form by any means without the express prior written permission of Arm. No license, express or implied, by estoppel or otherwise to any intellectual property rights is granted by this document unless specifically stated.

Your access to the information in this document is conditional upon your acceptance that you will not use or permit others to use the information for the purposes of determining whether implementations infringe any third party patents.

THIS DOCUMENT IS PROVIDED "AS IS". ARM PROVIDES NO REPRESENTATIONS AND NO WARRANTIES, EXPRESS, IMPLIED OR STATUTORY, INCLUDING, WITHOUT LIMITATION, THE IMPLIED WARRANTIES OF MERCHANTABILITY, SATISFACTORY QUALITY, NON-INFRINGEMENT OR FITNESS FOR A PARTICULAR PURPOSE WITH RESPECT TO THE DOCUMENT. For the avoidance of doubt, Arm makes no representation with respect to, and has undertaken no analysis to identify or understand the scope and content of, third party patents, copyrights, trade secrets, or other rights.

This document may include technical inaccuracies or typographical errors.

TO THE EXTENT NOT PROHIBITED BY LAW, IN NO EVENT WILL ARM BE LIABLE FOR ANY DAMAGES, INCLUDING WITHOUT LIMITATION ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, PUNITIVE, OR CONSEQUENTIAL DAMAGES, HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY, ARISING OUT OF ANY USE OF THIS DOCUMENT, EVEN IF ARM HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

This document consists solely of commercial items. You shall be responsible for ensuring that any use, duplication or disclosure of this document complies fully with any relevant export laws and regulations to assure that this document or any portion thereof is not exported, directly or indirectly, in violation of such export laws. Use of the word "partner" in reference to Arm's customers is not intended to create or refer to any partnership relationship with any other company. Arm may make changes to this document at any time and without notice.

If any of the provisions contained in these terms conflict with any of the provisions of any click through or signed written agreement covering this document with Arm, then the click through or signed written agreement prevails over and supersedes the conflicting provisions of these terms. This document may be translated into other languages for convenience, and you agree that if there is any conflict between the English version of this document and any translation, the terms of the English version of the Agreement shall prevail.

The Arm corporate logo and words marked with ® or ™ are registered trademarks or trademarks of Arm Limited (or its subsidiaries) in the US and/or elsewhere. All rights reserved. Other brands and names mentioned in this document may be the trademarks of their respective owners. Please follow Arm's trademark usage guidelines at <https://www.arm.com/company/policies/trademarks>.

Copyright © 2023 Arm® Limited (or its affiliates). All rights reserved.

Arm Limited. Company 02557590 registered in England.

110 Fulbourn Road, Cambridge, England CB1 9NJ.

(LES-PRE-20349)

Confidentiality status

This document is Non-Confidential. The right to use, copy and disclose this document may be subject to license restrictions in accordance with the terms of the agreement entered into by Arm and the party that Arm delivered this document to.

Unrestricted Access is an Arm internal classification.

Product status

The information in this document is for a product in development and is not final.

Feedback

Arm welcomes feedback on this product and its documentation. To provide feedback on Arm Neoverse V2 (MP158), create a ticket on <https://support.developer.arm.com>.

To provide feedback on the document, fill the following survey: <https://developer.arm.com/documentation-feedback-survey>.

Inclusive language commitment

Arm values inclusive communities. Arm recognizes that we and our industry have used language that can be offensive. Arm strives to lead the industry and create change.

If you find offensive language in this document, please email terms@arm.com.

Contents

rOp0 implementation fixes	7
rOp1 implementation fixes	8
Introduction	9
Scope	9
Categorization of errata	9
Change Control	10
Errata summary table	13
Errata descriptions	17
Category A	17
Category A (rare)	17
Category B	18
2331132 Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock	18
2394277 Translation table walk folding into an L1 prefetch might cause data corruption	20
2395412 A continuous stream of incoming DVM syncs may cause TRBE to prevent the core from forward progressing	21
2618597 Entry into the Full Retention power mode might cause corruption on ltag and BTB RAMs	22
2644884 L1 hardware prefetcher might cause deadlock	23
2662553 Static and dynamic TXREQ limiting might cause deadlock	24
2719103 The core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back	25
2719105 Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch	27
2743011 Page crossing access that generates an MMU fault on the second page could result in a livelock	28
2779510 The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation	29
2801372 The core might deadlock during powerdown sequence	30
3002998 PE executing DRPS during Debug Halt under Double Fault condition will not execute properly	31
3031173 SPE might write to pages which lack write permission at Stage-1 or Stage-2	32
Category B (rare)	34
2986655 PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level	34

Category C	36
2299866 Incorrect read value for Performance Monitors Control Register	36
2331130 MPAM value associated with instruction fetch might be incorrect	37
2331134 Noncompliance with prioritization of Exception Catch debug events	38
2446309 Software-step not done after exit from Debug state with an illegal value in DSPSR	40
2446525 PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly	41
2626876 Incorrect read value for Performance Monitors Configuration Register	42
2630907 Read to dump the instruction cache contents while in Debug state results in deadlock	43
2640782 PMU MEM_ACCESS_CHECKED_RD and MEM_ACCESS_CHECKED_WR inaccurate	44
2644885 ERXPFGCDN_EL1 register is incorrectly written on Warm reset	45
2644899 Incorrect sampling of SPE events "tlb_access" for an unaligned SVE load instruction with no active elements	46
2675381 FAR_ELx contents for a Data Abort exception on SVE first fault contiguous load instruction due to Tag Check fail might be incorrect	47
2694799 MTE tag check fail seen on first half of a cache-line crossing load does not get reported	48
2696811 Execution of STG instructions in close proximity might cause loss of MTE allocation tag data	49
2719108 Incorrect read value for Performance Monitors Configuration Register EX field	50
2719109 Incorrect value reported for SPE PMU event SAMPLE_FEED	51
2719111 MTE checked load might read an old value of allocation tag by not complying with address dependency ordering	52
2764406 Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP	53
2769032 STALL_BACKEND_MEM, Memory stall cycles AMU event count incorrectly	54
2794917 DGH instruction doesn't execute correctly	55
2801065 Incorrect decoding of SVE version of PRF* scalar plus scalar instructions	56
2802338 AMU Event 0x0011, Core frequency cycles might increment incorrectly when the core is in WFE state	58
2813403 PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM	59
2813408 Incorrect timestamp value reported in SPE records when timestamp capture is enabled	60
2814365 ECC errors in MTE allocation tags may lead to silent data corruption in tag values	61
2817024 TRBE buffer write translation out of context may have incorrect memory attributes	62

2914111	Accessing a memory location using mismatched Shareability attributes when MTE tag checking is enabled might cause data corruption	63
2933584	L2D_CACHE_WB_CLEAN overcounts	64
2985980	SPE latency counters are corrupted under certain conditions	65
2989895	IRG instructions might produce the wrong tag when GCR_EL1.RRND=0x0.	66

rOp0 implementation fixes

Note the following errata might be fixed in some implementations of rOp0. This can be determined by reading the REVIDR_EL1 register where a set bit indicates that the erratum is fixed in this part.

REVIDR_EL1[0]	2644884 L1 hardware prefetcher might cause deadlock
---------------	---

Note that there is no change to the MIDR_EL1 which remains at rOp0. Software will identify this release through the combination of MIDR_EL1 and REVIDR_EL1.

rOp1 implementation fixes

Note the following errata might be fixed in some implementations of rOp1. This can be determined by reading the REVIDR_EL1 register where a set bit indicates that the erratum is fixed in this part.

REVIDR_EL1[0]	2662553 Static and dynamic TXREQ limiting might cause deadlock
REVIDR_EL1[4]	2855383 Precise abort can lead to a deadlock

Note that there is no change to the MIDR_EL1 which remains at rOp1. Software will identify this release through the combination of MIDR_EL1 and REVIDR_EL1.

Introduction

Scope

This document describes errata categorized by level of severity. Each description includes:

- The current status of the erratum.
- Where the implementation deviates from the specification and the conditions required for erroneous behavior to occur.
- The implications of the erratum with respect to typical applications.
- The application and limitations of a workaround where possible.

Categorization of errata

Errata are split into three levels of severity and further qualified as common or rare:

Category A	A critical error. No workaround is available or workarounds are impactful. The error is likely to be common for many systems and applications.
Category A (Rare)	A critical error. No workaround is available or workarounds are impactful. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
Category B	A significant error or a critical error with an acceptable workaround. The error is likely to be common for many systems and applications.
Category B (Rare)	A significant error or a critical error with an acceptable workaround. The error is likely to be rare for most systems and applications. Rare is determined by analysis, verification and usage.
Category C	A minor error.

Change Control

Errata are listed in this section if they are new to the document, or marked as "updated" if there has been any change to the erratum text. Fixed errata are not shown as updated unless the erratum text has changed. The [errata summary table](#) identifies errata that have been fixed in each product revision.

30-Aug-2023: Changes in document version v7.0

ID	Status	Area	Category	Summary
3002998	New	Programmer	Category B	PE executing DRPS during Debug Halt under Double Fault condition will not execute properly
3031173	New	Programmer	Category B	SPE might write to pages which lack write permission at Stage-1 or Stage-2
2986655	New	Programmer	Category B (rare)	PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level
2794917	New	Programmer	Category C	DGH instruction doesn't execute correctly
2914111	New	Programmer	Category C	Accessing a memory location using mismatched Shareability attributes when MTE tag checking is enabled might cause data corruption
2933584	New	Programmer	Category C	L2D_CACHE_WB_CLEAN overcounts
2985980	New	Programmer	Category C	SPE latency counters are corrupted under certain conditions
2989895	New	Programmer	Category C	IRG instructions might produce the wrong tag when GCR_EL1.RRND=0x0

07-Mar-2023: Changes in document version v6.0

No new or updated errata in this document version.

16-Dec-2022: Changes in document version v5.0

ID	Status	Area	Category	Summary
2743011	New	Programmer	Category B	Page crossing access that generates an MMU fault on the second page could result in a livelock
2779510	New	Programmer	Category B	The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation
2801372	New	Programmer	Category B	The core might deadlock during powerdown sequence
2764406	New	Programmer	Category C	Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP
2769032	New	Programmer	Category C	STALL_BACKEND_MEM, Memory stall cycles AMU event count incorrectly
2801065	New	Programmer	Category C	Incorrect decoding of SVE version of PRF* scalar plus scalar instructions
2802338	New	Programmer	Category C	AMU Event 0x0011, Core frequency cycles might increment incorrectly when the core is in WFE state
2813403	New	Programmer	Category C	PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM
2813408	New	Programmer	Category C	Incorrect timestamp value reported in SPE records when timestamp capture is enabled
2814365	New	Programmer	Category C	ECC errors in MTE allocation tags may lead to silent data corruption in tag values
2817024	New	Programmer	Category C	TRBE buffer write translation out of context may have incorrect memory attributes

10-Aug-2022: Changes in document version v4.0

ID	Status	Area	Category	Summary
2662553	New	Programmer	Category B	Static and dynamic TXREQ limiting might cause deadlock
2719103	New	Programmer	Category B	Core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back
2719105	New	Programmer	Category B	Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch
2675381	New	Programmer	Category C	FAR_ELx contents for a Data Abort exception on SVE first fault contiguous load instruction due to Tag Check fail might be incorrect
2694799	New	Programmer	Category C	MTE tag check fail seen on first half of a cache-line crossing load does not get reported
2696811	New	Programmer	Category C	Execution of STG instructions in close proximity might cause loss of MTE allocation tag data
2719108	New	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register EX field
2719109	New	Programmer	Category C	Incorrect value reported for SPE PMU event SAMPLE_FEED
2719111	New	Programmer	Category C	MTE checked load might read an old value of allocation tag by not complying with address dependency ordering

02-May-2022: Changes in document version v3.0

ID	Status	Area	Category	Summary
2394277	Updated	Programmer	Category B	Translation table walk folding into an L1 prefetch might cause data corruption
2395412	Updated	Programmer	Category B	A continuous stream of incoming DVM syncs may cause TRBE to prevent the core from forward progressing
2618597	New	Programmer	Category B	Entry into the Full Retention power mode might cause corruption on ltag and BTB RAMs
2644884	New	Programmer	Category B	L1 hardware prefetcher might cause deadlock
2299866	New	Programmer	Category C	Incorrect read value for Performance Monitors Control Register
2446309	New	Programmer	Category C	Software-step not done after exit from Debug state with an illegal value in DSPSR
2446525	New	Programmer	Category C	PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly
2626876	New	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register
2630907	New	Programmer	Category C	Read to dump the instruction cache contents while in Debug state results in deadlock
2640782	New	Programmer	Category C	PMU MEM_ACCESS_CHECKED_RD and MEM_ACCESS_CHECKED_WR inaccurate
2644885	New	Programmer	Category C	ERXPFPGCDN_EL1 register is incorrectly written on Warm reset
2644899	New	Programmer	Category C	Incorrect sampling of SPE events "tlb_access" for an unaligned SVE load instruction with no active elements

17-Dec-2021: Changes in document version v2.0

ID	Status	Area	Category	Summary
2394277	New	Programmer	Category B	Translation table walk folding into an L1 prefetch might cause data corruption
2395412	New	Programmer	Category B	A continuous stream of incoming DVM syncs may cause TRBE to prevent the core from forward progressing

29-Oct-2021: Changes in document version v1.0

ID	Status	Area	Category	Summary
2331132	New	Programmer	Category B	Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock
2331130	New	Programmer	Category C	MPAM value associated with instruction fetch might be incorrect
2331134	New	Programmer	Category C	Noncompliance with prioritization of Exception Catch debug events

Errata summary table

The errata associated with this product affect the product versions described in the following table.

ID	Area	Category	Summary	Found in versions	Fixed in version
2331132	Programmer	Category B	Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock	r0p0, r0p1, r0p2	Open
2394277	Programmer	Category B	Translation table walk folding into an L1 prefetch might cause data corruption	r0p0	r0p1
2395412	Programmer	Category B	A continuous stream of incoming DVM syncs may cause TRBE to prevent the core from forward progressing	r0p0	r0p1
2618597	Programmer	Category B	Entry into the Full Retention power mode might cause corruption on ltag and BTB RAMs	r0p0, r0p1	r0p2
2644884	Programmer	Category B	L1 hardware prefetcher might cause deadlock	r0p0	r0p1
2662553	Programmer	Category B	Static and dynamic TXREQ limiting might cause deadlock	r0p0, r0p1	r0p2
2719103	Programmer	Category B	Core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back	r0p0, r0p1	r0p2
2719105	Programmer	Category B	Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch	r0p0, r0p1	r0p2
2743011	Programmer	Category B	Page crossing access that generates an MMU fault on the second page could result in a livelock	r0p0, r0p1	r0p2
2779510	Programmer	Category B	The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation	r0p0, r0p1	r0p2
2801372	Programmer	Category B	The core might deadlock during powerdown sequence	r0p0, r0p1	r0p2
3002998	Programmer	Category B	PE executing DRPS during Debug Halt under Double Fault condition will not execute properly	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
3031173	Programmer	Category B	SPE might write to pages which lack write permission at Stage-1 or Stage-2	r0p0, r0p1, r0p2	Open
2986655	Programmer	Category B (rare)	PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level	r0p0, r0p1, r0p2	Open
2299866	Programmer	Category C	Incorrect read value for Performance Monitors Control Register	r0p0	r0p1
2331130	Programmer	Category C	MPAM value associated with instruction fetch might be incorrect	r0p0, r0p1, r0p2	Open
2331134	Programmer	Category C	Noncompliance with prioritization of Exception Catch debug events	r0p0, r0p1, r0p2	Open
2446309	Programmer	Category C	Software-step not done after exit from Debug state with an illegal value in DSPSR	r0p0, r0p1, r0p2	Open
2446525	Programmer	Category C	PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly	r0p0	r0p1
2626876	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register	r0p0	r0p1
2630907	Programmer	Category C	Read to dump the instruction cache contents while in Debug state results in deadlock	r0p0, r0p1	r0p2
2640782	Programmer	Category C	PMU MEM_ACCESS_CHECKED_RD and MEM_ACCESS_CHECKED_WR inaccurate	r0p0	r0p1
2644885	Programmer	Category C	ERXPFCDN_EL1 register is incorrectly written on Warm reset	r0p0	r0p1
2644899	Programmer	Category C	Incorrect sampling of SPE events "tlb_access" for an unaligned SVE load instruction with no active elements	r0p0	r0p1
2675381	Programmer	Category C	FAR_ELx contents for a Data Abort exception on SVE first fault contiguous load instruction due to Tag Check fail might be incorrect	r0p0, r0p1	r0p2
2694799	Programmer	Category C	MTE tag check fail seen on first half of a cache-line crossing load does not get reported	r0p0, r0p1	r0p2

ID	Area	Category	Summary	Found in versions	Fixed in version
2696811	Programmer	Category C	Execution of STG instructions in close proximity might cause loss of MTE allocation tag data	r0p0, r0p1	r0p2
2719108	Programmer	Category C	Incorrect read value for Performance Monitors Configuration Register EX field	r0p0, r0p1	r0p2
2719109	Programmer	Category C	Incorrect value reported for SPE PMU event SAMPLE_FEED	r0p0, r0p1	r0p2
2719111	Programmer	Category C	MTE checked load might read an old value of allocation tag by not complying with address dependency ordering	r0p0, r0p1	r0p2
2764406	Programmer	Category C	Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP	r0p0, r0p1	r0p2
2769032	Programmer	Category C	STALL_BACKEND_MEM, Memory stall cycles AMU event count incorrectly	r0p0	r0p1
2794917	Programmer	Category C	DGH instruction doesn't execute correctly	r0p0, r0p1, r0p2	Open
2801065	Programmer	Category C	Incorrect decoding of SVE version of PRF* scalar plus scalar instructions	r0p0, r0p1	r0p2
2802338	Programmer	Category C	AMU Event 0x0011, Core frequency cycles might increment incorrectly when the core is in WFE state	r0p0, r0p1, r0p2	Open
2813403	Programmer	Category C	PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM	r0p0, r0p1	r0p2
2813408	Programmer	Category C	Incorrect timestamp value reported in SPE records when timestamp capture is enabled	r0p0, r0p1	r0p2
2814365	Programmer	Category C	ECC errors in MTE allocation tags may lead to silent data corruption in tag values	r0p0, r0p1, r0p2	Open
2817024	Programmer	Category C	TRBE buffer write translation out of context may have incorrect memory attributes	r0p0, r0p1, r0p2	Open
2914111	Programmer	Category C	Accessing a memory location using mismatched Shareability attributes when MTE tag checking is enabled might cause data corruption	r0p0, r0p1, r0p2	Open
2933584	Programmer	Category C	L2D_CACHE_WB_CLEAN overcounts	r0p0, r0p1, r0p2	Open

ID	Area	Category	Summary	Found in versions	Fixed in version
2985980	Programmer	Category C	SPE latency counters are corrupted under certain conditions	r0p0, r0p1, r0p2	Open
2989895	Programmer	Category C	IRG instructions might produce the wrong tag when GCR_EL1.RRND=0x0	r0p0, r0p1, r0p2	Open

Errata descriptions

Category A

There are no errata in this category.

Category A (rare)

There are no errata in this category.

Category B

2331132

Disabling of data prefetcher with outstanding prefetch TLB miss might cause a deadlock

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1, r0p2. Open.

Description

If the data prefetcher is disabled (by an MSR to CPUECTLR register) while a prefetch TLB miss is outstanding, the processor might deadlock on the next context switch.

Configurations Affected

All configurations are affected.

Conditions

- MSR write to CPUECTLR register that disables the data prefetcher.
- A TLB miss from the prefetch TLB is outstanding.

Implications

If the above conditions are met, a deadlock might occur on the next context switch.

Workaround

- Workaround option 1:
If the following code surrounds the MSR, it will prevent the erratum from happening:
 - CPP
 - DSB
 - ISB
 - MSR CPUECTLR - disabling the prefetcher
 - ISB
- Workaround option 2:
Place the data prefetcher in the most conservative mode instead of disabling it. This will greatly reduce prefetches but not eliminate them. This is accomplished by writing the following bits to the

value indicated:

- ECTLR2[14:11], PF_MODE= 4'b1001

2394277

Translation table walk folding into an L1 prefetch might cause data corruption

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

Description

A translation table walk that matches an existing L1 prefetch with a read request outstanding on CHI might fold into the prefetch, which might lead to data corruption for a future instruction fetch.

Configurations Affected

This erratum affects all configurations

Conditions

1. In specific microarchitectural situations, the PE merges a translation table walk request with an older hardware or software prefetch L2 cache miss request.

Implications

If the previous conditions are met, an unrelated instruction fetch might observe incorrect data.

Workaround

Disable folding of demand requests into older prefetches with L2 miss requests outstanding by setting CPUACTLR2_EL1[40] to 1.

2395412

A continuous stream of incoming DVM syncs may cause TRBE to prevent the core from forward progressing

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0. Fixed in r0p1.

Description

A continuous stream of incoming *Distributed Virtual Memory* (DVM) syncs might cause the *Trace Buffer Extension* (TRBE) to prevent the core from forward progressing, while executing a WFX.

Configurations Affected

This erratum affects all configurations.

Conditions

The erratum occurs if all the following conditions are met:

- The *Processing Element* (PE) executes a WFE or WFI instruction.
- TRBE is in use and needs to write trace data to its buffer.
- A continuous stream of DVM sync operations is received from other PEs.

Implications

When all of the above conditions are met, the PE might be prevented from entering WFE or WFI, and the pending WFE or WFI operation cannot be interrupted.

Workaround

There is no workaround.

2618597

Entry into the Full Retention power mode might cause corruption on Itag and BTB RAMs

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

If a core enters in Full Retention power mode, then the *Chip Enable* (CE) pin of Itag RAM or BTB RAM might be set. Physical RAMs don't support such states, so it leads to corruption when the core comes back to normal power mode and tries to reuse the RAM content.

Configurations Affected

This erratum affects all configurations.

This erratum affects implementations where RAM contents might be corrupted if the CE pin is asserted during retention.

Conditions

The erratum occurs if all the following conditions apply:

- The *Processing Element* (PE) enters the FULL_RET power state.
- The Itag or BTB RAMs are placed into a low-power mode during the PE FULL_RET power state.
- The PE power state transitions back to ON without going through the OFF power state.

Implications

If the conditions are met, the RAM contents of the itag and BTB RAMs might be corrupted. As a result, the PE might:

- Fetch and execute incorrect opcodes as a result of itag corruption.
- Predict incorrect targets from corrupted BTB RAMs.

Workaround

This erratum can be avoided by the firmware on power-on by disabling use of the Full Retention power mode in the core (setting IMP_CPUPWRCTLR_EL1.WFI_RET_CTRL to 0b000 and IMP_CPUPWRCTLR_EL1.WFE_RET_CTRL to 0b000).

2644884

L1 hardware prefetcher might cause deadlock

Status

Fault Type: Programmer Category B
Fault Status: Present in r0p0. Fixed in r0p1.

Description

Clock gating logic in the L2 cache might cause internal interface signals to remain asserted, leading to unexpected operation of one of the L1 data cache hardware prefetchers.

Configurations Affected

This erratum affects all configurations

Conditions

Hardware prefetching is enabled.

Implications

If the previous condition is met, unexpected operation, including deadlock, might occur.

Workaround

Disable the affected L1 data cache prefetcher by setting CPUACTLR6_EL1[41] to 'b1'. Doing so will incur a performance penalty of ~1%.

Contact Arm for an alternate workaround that impacts power.

2662553

Static and dynamic TXREQ limiting might cause deadlock

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

Use of the static and dynamic TXREQ limiting functions might cause a system deadlock. These functions are disabled by default.

Configurations Affected

This erratum affects all system configurations that include a component that can create a forward progress dependency on a older transaction through new transactions. Such components include the Chip-to-Chip Gateway block of CMN interconnect and PCIe Root Complexes.

Conditions

Under specific conditions involving request traffic to the specified components, the static and dynamic TXREQ limiting function might prevent a retried transaction from making forward progress.

Implications

If the above conditions are met, a retried CHI request might never be reissued, potentially leading to a system deadlock.

Workaround

Do not enable static or dynamic TXREQ limiting functions by keeping CPUECTLR2_EL1[2] at 0b0 and CPUECTLR2_EL1[1:0] at 0b00. These are the reset values.

2719103

The core might fetch stale instruction from memory when both Stage 1 Translation and Instruction Cache are Disabled with Stage 2 forced Write-Back

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

If a core is fetching instructions from memory while stage 1 translation is disabled and instruction cache is disabled, the core ignores Stage 2 forced Write-Back indication programmed by HCR_EL2.FWB and makes a Non-cacheable, Normal memory request. This may cause the core to fetch stale data from memory subsystem.

Configurations Affected

This erratum might affect system configurations that do not use Arm interconnect IP.

Conditions

The erratum occurs if all the following conditions apply:

- The *Processing Element* (PE) is using EL1 translation regime.
- Stage 2 translation is enabled (HCR_EL2.VM=1).
- Stage 1 translation is disabled (SCTLR_EL1.M=0).
- Instruction cache is enabled from EL2 (HCR_EL2.ID=0).
- Instruction cache is disabled from EL1 (SCTLR_EL1.I=0).

Implications

If the conditions are satisfied, the core makes all instruction fetch requests as Non-cacheable, Normal memory regardless of stage 2 translation output even if Stage 2 Forced Write-back is enabled. This might cause the core to fetch stale data from memory because Non-cacheable memory access does not probe any of cache hierarchy (e.g., Level-2 cache). If the bypassed cache hierarchy contains data modified by other initiators, stale data might be fetched from memory.

Workaround

For Hypervisor, initiating appropriate cache maintenance operations as if the core does not support stage 2 Forced Write-back feature. The cache maintenance operation should be initiated when new memory is allocated to a guest OS. This operation writeback the modified data in intermediate caches to point of coherency.

2719105

Continuous failing STREX because of another PE executing prefetch for store behind consistently mispredicted branch

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

A Processing Element (PE) executing a PLDW or PRFM PST instruction that lies on a mispredicted branch path might cause a second PE executing a store exclusive to the same cache line address to fail continuously.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. One PE is executing store exclusive.
2. A second PE has branches that are consistently mispredicted.
3. The second PE instruction stream contains a PLDW or PRFM PST instruction on the mispredicted path that accesses the same cache line address as the store exclusive executed by the first PE.
4. PLDW/PRFM PST causes an invalidation of the first PE's caches and a loss of the exclusive monitor.

Implications

If the above conditions are met, the store exclusive instruction might continuously fail.

Workaround

Set CPUACTLR2_EL1[0] to 1 to force PLDW/PRFM ST to behave like PLD/PRFM LD and not cause invalidations to other PE caches. There might be a small performance degradation to this workaround for certain workloads that share data.

2743011

Page crossing access that generates an MMU fault on the second page could result in a livelock

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

Under unusual micro-architectural conditions, a page crossing access that generates a *Memory Management Unit* (MMU) fault on the second page can result in a livelock.

Configurations Affected

All configurations are affected.

Conditions

This erratum occurs under all of the following conditions:

1. Page crossing load or store misses in the *Translation Lookaside Buffer* (TLB) and needs a translation table walk for both pages.
2. The table walk for the second page results in an MMU fault.

Implications

If the above conditions are met, under unusual micro-architectural conditions with just the right timing, the core could enter a livelock. This is expected to be very rare and even a slight perturbation due to external events like snoops could get the core out of livelock.

Workaround

This erratum can be avoided by setting CPUACTLR5_EL1[56:55] to 2'b01.

2779510

The PE might generate memory accesses using invalidated mappings after completion of a DVM SYNC operation

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

Description

The *Processing Element* (PE) might generate memory accesses using invalidated mappings after completion of a *Distributed Virtual Memory* (DVM) SYNC operation.

Configurations Affected

All configurations are affected.

Conditions

This erratum can occur on a PE (PE0) only if the affected TLBI and subsequent DVM SYNC operations are broadcast from another PE (PE1). The TLBI and DVM SYNC operations executed locally by PE0 are not affected.

Implications

When this erratum occurs, after completion of a DVM SYNC operation, the PE can continue generating memory accesses through mappings that were invalidated by a previous TLBI operation.

Workaround

The erratum can be avoided by setting CPUACTLR3_EL1[47]. Setting this chicken bit might have a small impact on power and negligible impact on performance.

2801372

The core might deadlock during powerdown sequence

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, and r0p1. Fixed in r0p2.

Description

While powering down the *Processing Element* (PE), a correctable L2 tag ECC error might cause a deadlock in the powerdown sequence.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. Error detection and correction is enabled through ERXCTLR_EL1.ED=1.
2. PE executes more than 24 writes to Device-nGnRnE or Device-nGnRE memory.
3. PE executes powerdown sequence as described in the Technical Reference Manual (TRM).

Implications

If the above conditions are met, the PE might deadlock during the hardware cache flush that automatically occurs as part of the powerdown sequence.

Workaround

Add a DSB instruction before the ISB of the powerdown code sequence specified in the TRM.

3002998

PE executing DRPS during Debug Halt under Double Fault condition will not execute properly

Status

Fault Type: Programmer Category B

Fault Status: Present in r0p0, r0p1 and r0p2. Open

Description

When a DRPS instruction is executed in Debug Halt state, a double fault should cause implicit ESB according to the Arm Architecture Reference Manual for A-profile architecture when (SCR_EL3.EA == '1' && SCR_EL3.NMEA == '1' && PSTATE.EL == EL3). However, the Processing Element (PE) will only execute part of the instruction for this case.

Configurations Affected

This erratum affects all configurations with double fault extension.

Conditions

This erratum occurs under the following conditions:

The PE is in Debug Halt state.

Software is currently executing at EL3 Exception level.

SCTLR_EL3.IESB == '0'

SCR_EL3.EA == '1' && SCR_EL3.NMEA == '1' indicating double fault.

Implications

The DRPS instruction is not executed correctly.

Workaround

When executing a DRPS instruction in EL3, set SCTLR_EL3.IESB to override double fault. Doing this will force the correct DRPS execution sequence to occur.

3031173

SPE might write to pages which lack write permission at Stage-1 or Stage-2

Status

Fault Type: Programmer Category B
Fault Status: r0p0, r0p1 and r0p2. Open.

Description

The *Statistical Profiling Extension* (SPE) uses the Stage-1 translation regime of the owning exception level in the owning Security state. Due to this erratum, the SPE might write to memory which lacks write permission at Stage-1 and/or Stage-2 of the owning exception level's translation regime, without raising a fault.

Configurations affected

This erratum affects all configurations that support SPE.

Conditions

This erratum occurs under the following conditions:

1. The SPE buffer is enabled.
2. Registers PMBPTR_EL1 and PMBLIMITR_EL1 are configured to include a virtual address VA_X.
3. A valid Stage-1 translation exists for the virtual address VA_X.
4. If Stage-2 is enabled, a valid Stage-2 translation exists for the intermediate physical address IPA_X for the virtual address VA_X.
5. At least one of the following conditions is true:
 - a. The Stage-1 translation for VA_X lacks write permission.
 - b. The Stage-2 translation for IPA_X lacks write permission.
6. None of the following apply:
 - a. Stage-1 hardware dirty bit management is enabled.
 - b. Stage-2 is enabled, and Stage-2 hardware dirty bit management is enabled.

Implications

The SPE might write to VA_X rather than generating a fault. This might allow malicious software with control over SPE to corrupt memory for which it is not intended to have write access to.

Workaround

No hardware workaround is available.

A hypervisor at EL2 should not give virtual machines control of SPE unless the hypervisor can handle writes to any pages mapped at Stage-2.

An OS kernel at EL1 or EL2 should not configure the SPE buffer to contain any page which might lack write permission at Stage-1.

No current software is expected to have this problem.

Category B (rare)

2986655

PE might incorrectly detect a Watchpoint debug event instead of a Data Abort exception on a page crossing memory access, resulting in errant entry to Debug state or routing the Data Abort exception to an incorrect Exception level

Status

Fault Type: Programmer Category B (Rare)

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

Description

Under certain conditions, the *Processing Element* (PE) might incorrectly detect a Watchpoint debug event instead of a Data Abort exception when a memory access spans multiple pages. The Data Abort is detected for the first page and the Watchpoint debug event is associated with the second page. The Watchpoint debug event detection might route the Data Abort to the incorrect target Exception level or cause the PE to enter Debug state.

Note the contents of the ESR and FAR registers capture the information associated with the Data Abort.

Configurations affected

This erratum affects all configurations.

Conditions

1. Watchpoints are enabled.
2. The PE executes a page split access that generates a Data Abort on the first page and a Watchpoint match on the second page.
3. The PE executes a younger load instruction that generates an external abort which coincides with a 1 cycle window when processing the Data Abort and Watchpoint debug event.

Implications

If the previous conditions are met and EDSCR.HDE is set (enables Halting Debug on Watchpoint debug event), then the PE will enter Debug state rather than taking a Data Abort exception.

If EDSCR.HDE is not set, the PE might route the abort to the incorrect Exception level:

- If MDCR_EL2.TDE == 0, a stage 2 Data Abort might result in a Data Abort exception taken erroneously to EL1.

- The rarity of PE internal timings required to exhibit this bug is comparable to *Reliability, Availability, and Serviceability* (RAS) error FIT rates. Expected outcome is a kernel panic that will kill the process.
- If `MDCR_EL2.TDE == 1`, a stage 1 Data Abort might result in a Data Abort exception taken erroneously to EL2.
 - This scenario is containable within a hypervisor via the software workaround outlined below.

Workaround

There is no complete workaround for this erratum. A partial software workaround addresses the more serious scenario of a stage 1 Data Abort resulting in a Data Abort exception taken erroneously to EL2 without updating `HPFAR_EL2`.

EL2 can protect against this case as follows:

- Reserve one bit of IPA space so that `VTCTR_EL2.PS` is never the maximum supported.
- Write all 1's to `HPFAR_EL2[63:0]` before entering EL1 or EL0.
- Exceptions to EL2 due to this erratum that should have set `HPFAR_EL2` will instead use an out of range IPA. The guest should be restarted as the conditions for this erratum are rare and are not likely to be encountered again.

Category C

2299866

Incorrect read value for Performance Monitors Control Register

Status

Fault Type: Programmer Category C
Fault Status: Present in r0p0. Fixed in r0p1.

Description

The Performance Monitors Control Register (PMCR_ELO) and the External Performance Monitor Control Register (PMCR) might return an incorrect read value for the X field.

Configurations Affected

This erratum affects all configurations.

Conditions

1. Software writes a nonzero value to the PMCR_ELO.X, or debugger writes a nonzero value to the PMCR.X
2. Software reads the PMCR_ELO register, or debugger reads the PMCR register

Implications

The PMCR_EL1.X or PMCR.X field incorrectly reports the value 0x1, indicating exporting of events in an IMPLEMENTATION DEFINED PMU event export bus is enabled. The expected value is 0x0, as the implementation does not include a PMU event export bus.

Workaround

This erratum has no workaround.

2331130

MPAM value associated with instruction fetch might be incorrect

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

Description

Under some scenarios, the MPAM value associated with an instruction fetch request might be incorrect when context changes.

Configurations Affected

This erratum affects all configurations.

Conditions

1. An Instruction fetch request is attempted before a context switch but is not completed until after a context switch.

Implications

The MPAM value associated with the instruction fetch request might be incorrect.

Workaround

There is no workaround.

2331134

Noncompliance with prioritization of Exception Catch debug events

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

Description

ARMv8.2 architecture requires that Debug state entry due to an Exception Catch debug event (generated on exception entry) occur before any asynchronous exception is taken at the first instruction in the exception handler. An asynchronous exception might be taken as a higher priority exception than Exception Catch and the Exception Catch might be missed altogether.

Configurations Affected

This erratum affects all configurations.

Conditions

1. Debug Halting is allowed.
2. EDECCR bits are configured to catch exception entry to ELx.
3. A first exception is taken resulting in entry to ELx.
4. A second, asynchronous exception becomes visible at the same time as exception entry to ELx.
5. The second, asynchronous exception targets an Exception level ELy that is higher than ELx.

Implications

If the above conditions are met, the core might recognize the second exception and not enter Debug state as a result of Exception Catch on the first exception. When the handler for the second exception completes, software might return to execute the first exception handler, and assuming the core does not halt for any other reason, the first exception handler will be executed and entry to Debug state via Exception Catch will not occur.

Workaround

When setting Exception Catch on exceptions taken to an Exception level ELx, the debugger should do either or both of the following:

1. Ensure that Exception Catch is also set for exceptions taken to all higher Exception Levels, so that the second (asynchronous) exception generates an Exception Catch debug event.
2. Set Exception Catch for an Exception Return to ELx, so that when the second (asynchronous)

exception handler completes, the exception return to ELx generates an Exception Catch debug event.

Additionally, when a debugger detects that the core has halted on an Exception Catch to an Exception level ELy, where $y > x$, it should check the ELR_ELy and SPSR_ELy values to determine whether the exception was taken on an ELx exception vector address, meaning an Exception Catch on entry to ELx has been missed.

2446309

Software-step not done after exit from Debug state with an illegal value in DSPSR

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

Description

On exit from Debug state, PSTATE.SS is set according to DSPSR.SS and DSPSR.M.

If DSPSR.M encodes an illegal value, then PSTATE.SS should be set according to the current Exception level. When the erratum occurs, the PE always writes PSTATE.SS to 0.

Configurations Affected

This erratum affects all configurations.

Conditions

- Software-step is enabled in current Exception level
- DSPSR.M encodes an illegal value, like:
 - M[4] set
 - M is a higher Exception level than current Exception level
 - M targets EL2 or EL1, when they are not available
- DSPSR.D is not set
- DSPSR.SS is set

Implications

If the previous conditions are met, then, on exit from Debug state the PE will directly take a Software-step Exception, without stepping an instruction as expected from DSPSR.SS=1.

Workaround

This erratum has no workaround.

2446525

PMU STALL_SLOT_BACKEND and STALL_SLOT_FRONTEND events count incorrectly

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

Description

The following Performance Monitoring Unit (PMU) events do not count correctly:

- 0x3D, STALL_SLOT_BACKEND, no operation sent for execution on a slot due to the backend
- 0x3E, STALL_SLOT_FRONTEND, no operation sent for execution on a slot due to the frontend

Configurations Affected

This erratum affects all configurations.

Conditions

One of the PMU event counters is configured to count any of the following events:

- 0x3D, STALL_SLOT_BACKEND
- 0x3E, STALL_SLOT_FRONTEND

Implications

When operations are stalled in the processing element's dispatch pipeline slot, some of those slot stalls are counted as frontend stalls when they should have been counted as backend stalls, rendering PMU events 0x3D (STALL_SLOT_BACKEND) and 0x3E (STALL_SLOT_FRONTEND) inaccurate. The PMU event 0x3F (STALL_SLOT) does still accurately reflect its intended count of "No operation sent for execution on a slot".

Workaround

This erratum has no workaround.

2626876

Incorrect read value for Performance Monitors Configuration Register

Status

Fault Type: Programmer Category C
Fault Status: Present in r0p0. Fixed in r0p1.

Description

The Performance Monitors Configuration Register (PMCFGR) returns an incorrect read value for the CCD field.

Configurations Affected

This erratum affects all configurations.

Conditions

1. Debugger reads the PMCFGR register.

Implications

The PMCFGR.CCD field incorrectly reports the value 0x1 indicating that Cycle counter has prescale, instead of the expected value of 0x0, since the field is RAZ if AArch32 isn't supported.

Workaround

There is no workaround.

2630907

Read to dump the instruction cache contents while in Debug state results in deadlock

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, and r0p1. Fixed in r0p2.

Description

In Debug state, an access to read the instruction cache data contents using SYS_IMP_RAMINDEX will not complete and will deadlock any ITR transactions that follow.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs if all the following conditions apply:

1. The PE enters Debug state.
2. User sets SYS_IMP_RAMINDEX RAM_ID field to 0x1 in order to select the read of instruction cache contents, and performs the read.

Implications

The instruction cache read deadlocks, and the debugger might lose control.

Workaround

This erratum can be avoided by the debugger if the instruction cache is not read when the core is in Debug state.

2640782

PMU MEM_ACCESS_CHECKED_RD and MEM_ACCESS_CHECKED_WR inaccurate

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

Description

The MEM_ACCESS_CHECKED_RD and MEM_ACCESS_CHECKED_WR PMU events increment incorrectly when accessing a tagged page, but is inactive due to SVE predication.

Configurations Affected

This erratum affects configurations with BROADCASTMTE=1.

Conditions

This erratum occurs if the following conditions apply:

1. a load or store access crosses a page-boundary
2. one unaligned half accesses a page that is MTE tagged, but is inactive due to SVE predication
3. the other unaligned half accesses a page that is not MTE tagged

Implications

If the previous conditions are met, the PMU event might increment inaccurately.

Workaround

This erratum has no workaround.

2644885

ERXPFGCDN_EL1 register is incorrectly written on Warm reset

Status

Fault Type: Programmer Category C
Fault Status: Present in r0p0. Fixed in r0p1.

Description

The ERXPFGCDN_EL1 register is written a reset value of 0 at both cold and Warm reset, when it should only be reset at Cold reset.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs when a Warm reset occurs.

Implications

If the previous condition is met, the value of ERXPFGCDN_EL1 will not be preserved across a Warm reset.

Workaround

This erratum has no workaround.

2644899

Incorrect sampling of SPE events "tlb_access" for an unaligned SVE load instruction with no active elements

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

Description

Under certain circumstances, the SPE events E[4] "TLB Access" might not be captured as required.

Configurations Affected

This erratum affects all configurations.

Conditions

SPE samples an unaligned SVE load instruction with no active elements.

Implications

If the previous conditions are met, then the SPE events E[4] "TLB Access" might not be consistent with the PMU event 0x0025 (L1D_TLB). Note that PMU event 0x0025 (L1D_TLB) is accurate.

Workaround

This erratum has no workaround.

2675381

FAR_ELx contents for a Data Abort exception on SVE first fault contiguous load instruction due to Tag Check fail might be incorrect

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

A *Scalable Vector Extension* (SVE) first fault contiguous load instruction that encounters a Tag Check fail when accessing the first active element and a watchpoint match on one of the non-first active elements can generate a Data abort exception with incorrect value in FAR_ELx.

Configurations Affected

All configurations are affected.

Conditions

This erratum occurs under all of the following conditions:

1. Memory tagging and watchpoints are enabled.
2. An SVE first fault contiguous load instruction accesses memory and generates a Data Abort exception due to Tag Check fail on the first active element.
3. There is a watchpoint match on one of the non-first active elements.

Implications

If the above conditions are met, a Data Abort exception will be generated with an incorrect value in FAR_ELx. ESR_ELx will indicate Synchronous Tag Check Fault.

Workaround

This erratum has no workaround.

2694799

MTE tag check fail seen on first half of a cache-line crossing load does not get reported

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

Under some unusual microarchitectural conditions, tag check fail seen on first half of a cache-line crossing load does not get reported.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under all of the following conditions:

1. Memory tagging is enabled
2. Cache-line crossing load is executed that fails tag check on first half of the access
3. Unusual microarchitectural conditions occur

Implications

If the above conditions are met, precise checked loads that see tag mismatch will not report an exception and imprecise checked loads will not update the TFSR register.

Workaround

This erratum has no workaround.

2696811

Execution of STG instructions in close proximity might cause loss of MTE allocation tag data

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

Under certain rare micro-architectural conditions, two or more STG instructions that access the same cacheline but different 32-bytes might not write the *Memory Tagging Extension* (MTE) allocation tag to memory in the presence of an ECC error to the same cache index.

Configurations Affected

This erratum affects all configurations where the BROADCASTMTE pin is HIGH.

Conditions

1. Memory tagging is enabled.
2. Two or more STG instructions are executed in close proximity to the same cache line.
3. The STG instructions access different 32-bytes locations.
4. An L2 fill for a different cacheline but to the same index has a single bit data error that could have otherwise caused a capacity evict of the cacheline accessed by the STG instructions

Implications

If the above conditions are met, then under specific micro-architectural conditions, the MTE allocation tag might not be written to memory, resulting in a silent corruption of the MTE tag.

Workaround

If desired, this erratum can be avoided by setting CPUACTLR5_EL1[13] to 1.

Note: setting CPUACTLR5_EL1[13] to 1 is expected to result in a small performance degradation for workloads that use MTE (approximately 1.6% when using MTE imprecise mode, 0.9% for MTE precise mode).

2719108

Incorrect read value for Performance Monitors Configuration Register EX field

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

The Performance Monitors Configuration Register (PMCFGR) might return an incorrect read value for the EX field.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs when the software reads the PMCFGR register.

Implications

The PMCFGR.EX field incorrectly reports the value 0x1, indicating exporting of events in an IMPLEMENTATION DEFINED PMU event export bus is enabled. The expected value is 0x0, as the implementation does not include a PMU event export bus.

Workaround

This erratum has no workaround.

2719109

Incorrect value reported for SPE PMU event SAMPLE_FEED

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1, Fixed in r0p2.

Description

Under certain conditions when a CMP instruction is followed by a Branch, the SAMPLE_FEED PMU event 0x4001 is not reported.

Configurations Affected

This erratum affects all configurations.

Conditions

1. *Statistical Profiling Extension* (SPE) sampling is enabled.
2. SPE samples a CMP instruction, which is followed immediately by a BR instruction.

Implications

If the above conditions are met, then the SAMPLE_FEED event may not be incremented.

For most expected use cases, the inaccuracy is not expected to be significant.

Workaround

There is no workaround.

2719111

MTE checked load might read an old value of allocation tag by not complying with address dependency ordering

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0 and r0p1. Fixed in r0p2.

Description

Under some unusual micro-architectural conditions, checked load might read an old value of allocation tag by not complying with address dependency ordering.

Configurations Affected

All configurations are affected.

Conditions

The erratum occurs when all the following apply:

1. Initially, memory location M has allocation tag A.
2. *Processing Element* x (PE_x) stores to M using allocation tag A.
3. PE_y changes the allocation tag of M from A to B.
4. PE_x makes a checked load from M using allocation tag A, with a dependency such that it should observe allocation tag B.

Implications

If the above conditions are met, PE_x may not observe the new allocation tag for the memory location and may fail to report a tag check fail.

Workaround

This erratum has no workaround.

2764406

Incorrect value reported for SPE PMU event 0x4000 SAMPLE_POP

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, and r0p1. Fixed in r0p2.

Description

Under certain conditions the SAMPLE_POP PMU event 0x4000 might continue to count after SPE profiling has been disabled.

Configurations Affected

This erratum affects all configurations.

Conditions

1. *Statistical Profiling Extension* (SPE) sampling is enabled.
2. *Performance Monitoring Unit* (PMU) event counting is enabled.
3. SPE buffer is disabled, either directly by software, or indirectly via assertion of PMBIRQ, or by entry into Debug state.

Implications

If the previous conditions are met, then the SAMPLE_POP event might reflect an overcounted value. The impact of this erratum is expected to be very minor for actual use cases, as SPE sampling analysis is typically performed independently from PMU event counting.

Workaround

If a workaround is desired, then minimization of potential overcounting of the SAMPLE_POP event can be realized via software disable of any PMU SAMPLE_POP event counters whenever SPE is disabled, and also upon the servicing of a PMBIRQ interrupt. For profiling of ELO workloads, software can further reduce exposure to overcounting by configuring the counter to not count at Exception levels of EL1 or higher.

2769032

STALL_BACKEND_MEM, Memory stall cycles AMU event count incorrectly

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0. Fixed in r0p1.

Description

The following *Activity Monitor Unit* (AMU) event does not count correctly:

- 0x4005, STALL_BACKEND_MEM. The counter counts cycles in which the PE is unable to dispatch instructions from the frontend to the backend of the PE. It is due to a backend stall caused by a miss in the last level of cache within the PE clock domain. This event is counted by AMEVCNTR03.

Configurations Affected

This erratum affects all configurations.

Conditions

- AMU is enabled

Implications

The counter values for the event will not be correct and therefore cannot be used reliably.

Workaround

This erratum has no workaround.

2794917

DGH instruction doesn't execute correctly

Status

Fault Type; Programmer Category C
Fault Status: Present in rOp0, rOp1 and rOp2. Open

Description

DGH instructions are executed as PSBs. The DGH target address is ignored.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. A DGH instruction is executed.

Implications

If Profiling is not enabled, then the PSB will execute as a NOP. Performant code sequences that depend on DGH for explicit memory management will not see the expected speedup, but will see no additional slowdown.

If Profiling is enabled, then the PSB instruction might take up to tens of cycles to complete, causing an additional slowdown.

Since neither DGH nor PSB affect the architected state, there is no functional problem.

Workaround

No workaround is expected to be necessary.

2801065

Incorrect decoding of SVE version of PRF* scalar plus scalar instructions

Status

Fault Type: Programmer Category C

Fault Status: Present in rOp0, rOp1. Fixed in rOp2.

Description

Scalar plus Scalar forms of the *Scalable Vector Extension* (SVE) PRF may not prefetch from the correct address. The address should be $X_n + X_m \ll \text{scalar}$, but is instead calculated as X_n . This affects the following instructions:

- PRFB (scalar plus scalar)
- PRFH (scalar plus scalar)
- PRFW (scalar plus scalar)
- PRFD (scalar plus scalar)

Configurations Affected

This erratum affects all configurations.

Conditions

1. Any of the above instructions are executed without trapping when $X_m \neq 0x0$

Implications

All affected instructions are software prefetches which do not affect architectural state in any way (including suppression of any translation faults). Thus this erratum will not affect the functional operation of the CPU. Since these instructions are likely to be used in contexts where X_n is fixed and X_m is incrementing, it is unlikely that the erroneous prefetches would result in undesired cache pollution or reduction in memory bandwidth because the instructions will simply continuously prefetch the same address.

Workaround

No workaround is expected to be necessary, but if one is specifically needed, the programmer can use an ADD, and then one of the immediate forms of SVE PRF, which are unaffected. These instructions are:

- PRFB (scalar plus immediate)
- PRFH (scalar plus immediate)

- PRFW (scalar plus immediate)
- PRFD (scalar plus immediate)

2802338

AMU Event 0x0011, Core frequency cycles might increment incorrectly when the core is in WFE state

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, r0p2. Open.

Description

The core frequency cycles Activity Monitor Unit (AMU) event may not count correctly when the core is in Wait For Event (WFE) state and the clocks in the core are enabled.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. The architected activity monitor counter register 0 (AMEVCNTR00) is enabled.
2. The core executes WFE instructions.
3. The clocks in the core are never disabled, or
4. The clocks in the core are temporarily enabled without causing the core to exit WFE state due to one of the following events:
 - A system snoop request that must be serviced by the core L1 data cache or the L2 cache.
 - A cache or Translation Lookaside Buffer (TLB) maintenance operation that must be serviced by the core L1 instruction cache, L1 data cache, L2 cache, or TLB.
 - An access on the Utility bus interface.
 - A Generic Interrupt Controller (GIC) CPU access or debug access through the Advanced Peripheral Bus (APB) interface.

Implications

The core frequency cycles AMU event will continue to increment when clocks are enabled even though the core is in WFE state. Arm expects this to be a minor issue as the resulting discrepancies will likely be negligible from the point of view of consuming these counts in the system firmware at the 1ms level.

Workaround

There is no workaround.

2813403

PE might fail to detect multiple uncorrectable ECC errors in the L1 data cache tag RAM

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, and r0p1. Fixed in r0p2.

Description

Under certain conditions, the *Processing Element* (PE) might fail to report multiple uncorrectable *Error Correction Code* (ECC) errors that occur in the L1 data cache tag RAM.

Configurations affected

This erratum affects all configurations.

Conditions

1. The PE detects and reports an uncorrectable ECC error in the L1 data cache tag RAM.
2. The PE detects a second uncorrectable ECC error in the L1 data cache tag RAM and an uncorrectable ECC error in the L1 data cache data RAM.

Implications

If the previous conditions are met, then the PE might fail to report the second uncorrectable ECC error in the L1 data cache tag RAM and the address recorded in `ERR0ADDR` might have an incorrect value. The ECC error occurring in the L1 data cache data RAM is reported correctly.

Workaround

No workaround is necessary. This erratum represents a condition where multiple uncorrectable ECC errors occur in a short period of time. While the PE does not report the errors correctly, ECC still provides a valuable mechanism for error detection and correction.

2813408

Incorrect timestamp value reported in SPE records when timestamp capture is enabled

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1. Fixed in r0p2.

Description

The timestamp value that is captured in the *Statistical Profiling Extension* (SPE) records may be incorrect.

Configurations Affected

This erratum affects all configurations.

Conditions

1. Timestamp capture is enabled for SPE records at the appropriate Exception level by setting PMSCR_EL1.TS or PMSCR_EL2.TS.

Implications

If the above conditions are met, then the timestamp value reported in the SPE records might be stale (off by one tick) or zero in some cases.

Workaround

There is no workaround.

2814365

ECC errors in MTE allocation tags may lead to silent data corruption in tag values

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

Description

Streaming writes that require *Memory Tagging Extension* (MTE) tags for tag checking or merging with data receive allocations tags that are flagged as poisoned may lead to the *Processing Element* (PE) caching data and tags with no indication that the tags are poisoned. This may lead to silent data corruption on the allocation tags.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. The PE performs a streaming write (a write of 64 contiguous bytes gathered from multiple store or DC ZVA operations).
2. Streaming write requires MTE tag check or hits in the PE caches to a line that contains MTE allocation tags.
3. MTE allocations tags contain an indication of an error (uncorrectable ECC error or poison flag).

Implications

If the above conditions are met, the PE might merge the streaming write data and the MTE allocation tags containing an error and write data and allocation tags to a cache without marking the tags as poisoned. This can lead to silent data corruption to future consumers of the MTE allocation tags, which may result in incorrect MTE tag check results. The net effect is an increase in the SDC FIT rate of the PE.

There is still substantial benefit being gained from the ECC logic.

Workaround

There is no workaround.

2817024

TRBE buffer write translation out of context may have incorrect memory attributes

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1, and r0p2. Open.

Description

When TRBLIMITR_EL1.nVM = 1, TBE_OWNING_EL = EL1, and TRBE requests a translation while the *Processing Element* (PE) is executing in EL2 or EL3, and cache is disabled by HCR_EL2.CD = 1, memory attribute may not be Non-cacheable.

Configurations affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. TRBLIMITR_EL1.nVM is set to 1.
2. MDCR_EL2.E2TB is set to 0b10 or 0b11.
3. HCR_EL2.CD is set to 1.
4. The PE is executing in EL2 or EL3.
5. TRBE requests a translation for a buffer write.

Implications

Memory attributes for any write access by TRBE to that translation may not be forced to Non-cacheable.

Workaround

Use of HCR_EL2.CD is not expected to be common. If a workaround is needed, do not allow TRBE to be given to a VM machine.

2914111

Accessing a memory location using mismatched Shareability attributes when MTE tag checking is enabled might cause data corruption

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

Description

A PE accessing a same physical memory location with mismatched Shareability attributes and requiring a read of *Memory Tagging Extension* (MTE) tags might result in data corruption.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. PE accesses a physical memory location using cacheable and Non-shareable attributes.
2. PE accesses the same physical address using cacheable and shareable attributes with MTE checking enabled.

Implications

If the previous conditions are met, the PE might expose stale data from the PE caches established by a Non-shareable access. This data might become visible to shareable observers in the same Shareability domain, even if the PE performs the required cache maintenance for ensuring ordering and coherency when aliasing Shareability.

Workaround

Arm expects that operating systems do not use mismatched Shareability attributes for aliases of the same memory location for tagged pages.

2933584

L2D_CACHE_WB_CLEAN overcounts

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

Description

Counting of the L2D_CACHE_WB_CLEAN event includes transfer of data directly to another *Processing Element* (PE) using the AMBA CHI Direct Cache Transfer mechanism.

Configurations Affected

This erratum affects all configurations.

Conditions

This erratum occurs under the following conditions:

1. The PE processes a forwarding snoop from the DSU or Fully coherent Home Node (HN-F) and sends data directly to another PE using a CompData message.

Implications

If the previous condition is met, the PE will count the L2D_CACHE_WB_CLEAN event contrary to the architectural specification of this event.

Workaround

No workaround is required for this erratum.

2985980

SPE latency counters are corrupted under certain conditions

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

Description

Under certain conditions, the dispatch to issue and dispatch to completion latency counters for certain Statistical Profiling samples might be corrupted.

Configurations Affected

This erratum affects all configurations.

Conditions

1. Statistical profiling is enabled at the appropriate Exception level.
2. The first instruction sampled is one of the following instructions:
 - FADDA
 - BFMMLA
 - FDIV
 - FSQRT
3. The sample gets flushed under certain micro-architectural conditions.
4. The next sample of one of the above instructions might capture incorrect latency values.

Implications

If the above conditions are met, the dispatch to issue and dispatch to completion counts for certain samples of FADDA, BFMMLA, FDIV, or FSQRT in the *Statistical Profiling Extension* (SPE) buffer might be corrupted.

Workaround

There is no workaround.

2989895

IRG instructions might produce the wrong tag when GCR_EL1.RRND=0x0.

Status

Fault Type: Programmer Category C

Fault Status: Present in r0p0, r0p1 and r0p2. Open.

Description

When the *Processing Element* (PE) is configured with GCR_EL1.RRND=0x0, writing SCTLR_EL3.ATA, SCTLR_EL2.ATA, SCTLR_EL1.ATA, or SCTLR_EL1.ATA0 can corrupt internal state. As a result IRG instructions might produce the wrong tag.

Configurations Affected

This erratum affects all configurations with MTEDISABLE=0x0.

Conditions

This erratum occurs under the following conditions:

1. The PE is executing with GCR_EL1.RRND=0x0.
2. An IRG instruction is executed.
3. An MSR is executed which updates any of SCTLR_EL3.ATA, SCTLR_EL2.ATA, SCTLR_EL1.ATA, or SCTLR_EL1.ATA0.
4. An IRG instruction is executed.

Implications

If the above conditions are met, the tag produced by the second or any subsequent IRG instruction might be incorrect.

Workaround

Arm is not aware of any software which uses the GCR_EL1.RRND=0x0 configuration. If your system uses this configuration, please contact Arm Customer Support for more information.